

City Nos.	Name of Street.	Owner and Occupancy.	MATERIAL.		DIMENSIONS.			CONDITION OF WALLS.				Condition of Chimneys or Flues.	Damages by Earthquake.	What should be done to make it safe.	Remarks.
			Building.	Roof.	Ft. Long.	Ft. Wide.	Ft. High.	North.	South.	East.	West.				
18	East Side Savage	John Adams, Dwelling	Frame	Tin	38	18	24	Good	Good	Good	Good	Good		Foundation needs immediate attention	
20	" "	John Harrison, Dwelling	Frame	Tin	35	16	25	Good	Good	Good	Good	Down below roof	50	Chimneys should be carefully built below eaves; repair foundations	
22	" "	Henry Oliver, Dwelling	Frame	Tin	35	16	22	Good	Good	Good	Good	Down below roof	50	Same as above	
24	" "	J. LaPrade, Dwelling	Frame	Slate	35	16	22	Good	Good	Good	Good	Good		O K	
26-28	" "	J. Golden, Dwelling	Frame	Tin	40	18	25	Good	Good	Good	Good	Have all been rebuilt	100	New O K	
30	" "	Dwelling	Frame	Tin	38	20	20	Good	Good	Good	Good	Good		O K	Stovepipe in rear should be carried higher
36	" "	T. Darcy, Dwelling	Frame	Tin	35	22	22	Good	Good	Good	Good	Have been rebuilt		O K	One stovepipe and terra cotta pipe in rear
38	" "	" "	Frame	Tin	35	22	22	Good	Good	Good	Good	Good		O K	Stovepipe in rear
40	" "	J. Thompson, Dwelling	Frame	Tin	40	16	25	Good	Good	Good	Good	Good		O K	
42	" "	" "	Frame	Tin	60	16	25	Good	Good	Good	Good	Good		O K	
44	" "	A. Lindstrom, Dwelling	Frame	Tin	40	16	20	Good	Good	Good	Good	Good	75	New O K	
46	" "	J. Thompson, Dwelling	Frame	Tin	40	16	25	Good	Good	Good	Good	Rebuilt	75	New O K	
48	" "	" "	Frame	Tin	40	16	25	Good	Good	Good	Good	Repaired	40	O K	
17	West Side Savage	I. Parker, Dwelling	Frame	Tin	30	17	22							Unfinished building	
19	" "	V. Nymon, Dwelling	Frame	Tin	28	14	20	Good	Good	Good	Good	Good		O K	
21	" "	" "	Frame	Tin	28	14	20	Good	Good	Good	Good	New being rebuilt	100	New O K	
23	" "	Miss S. H. Simmons, Dwelling	Frame	Tin	40	24	20	Good	Good	Good	Good	Rebuilt	75	New O K	
25	" "	" "	Frame	Tin	40	16	24	Good	Good	Good	Good	Repaired		New O K	
27	" "	J. Hammond	Frame	Tin	36	22	25	Good	Good	Good	Good	Good		O K	
29	" "	W. F. Osterdorf, Dwelling	Frame	Tin	36	22	25	Good	Good	Good	Good	Good		O K	
31	" "	" "	Frame	Tin	20	40	20	Good	Good	Good	Good	Repaired	65	O K	
✓ 33	" "	B. Lutton, Dwelling	Frame	Tin	40	16	20	Good	Good	Good	Good	Repaired	45	O K	
10	East Side Lincoln	F. H. Frost, Dwelling	Brick	Slate				Good	Cracked	Very bad	Disastrously cracked	Down	1200	Rebuild the greater portion of east and west walls; rebuild chimneys	One north is a one-story frame and large old chimney
14	" "	" "	Brick	Slate	35	18	25	Good	Good	Portion should be taken down	Cracked at openings	Down	500	Rebuild and anchor cracked parts of west wall. Rebuild cracked portions of east wall; rebuild chimneys and repair and anchor kitchen	
20	" "	" "	Frame	Tin	50	22	35							New being rebuilt	
1	West Side Lincoln	S. Matthews, Negro Tenement Row	Frame	Tin	80	12	18	Old frame	Old frame	Old frame	Old frame	Good		Old frame, rough boards	
3	" "	S. Matthews, Dwelling	Frame	Tin	60	18	25	Good	Good	Good	Good	Good		O K	
5	" "	" "	Frame	Tin	60	18	25	Good	Good	Good	Good	Rebuilt	75	O K	
7	" "	" "	Brick	Slate	50	18	25	Repaired	Repaired	Repaired	Repaired	Repaired	350	New O K	
9	" "	A. H. Jones, Dwelling	Brick	Slate	60	26	30	Good	Good	Cracked	Good	Rebuilt		Rebuild and anchor east wall between windows	
15	" "	H. S. Hall, Dwelling	Brick	Slate	40	18	30	Cracked and down	Cracked and portion down	Down	Cracked and portion down	Down	3500	Building almost complete wreck	
17	" "	Wm. McKinley	Brick	Slate	60	17	25	Good	Good	Good	Good	Rebuilt	75	Repair foundation; O K	
19	" "	W. Flynn, Dwelling	Frame	Slate	60	17	25	Good	Good	Good	Good	Rebuilt	75	O K	
4	East Side Greenhill	C. Frutkinson, Dwelling	Frame	Tin				Good	Good	Good	Good	Down		Rebuild chimneys; O K	
2	" "	H. Jordan & Son, Store and Dwelling	Frame	Tin	75	30	28	Good	Good	Good	Good	Down		Rebuild chimneys; O K	
7	West Side Greenhill	Edward Hughes, Dwelling	Frame	Tin	40	20	20	Old frame	Old frame	Old frame	Old frame	Rebuilt	48	New O K	
5	" "	B. Warren, Dwelling	Frame	Tin	15	12	20	Old frame	Old frame	Old frame	Old frame	None		Stovepipe through roof	
3	" "	J. Taylor, Dwelling	Brick	Slate	25	15	18	Good	Good	Good	Good	Good		O K	
1	" "	J. Redbrook, Dwelling	Brick	Tile				Good	Good	Badly cracked	Cracked	Down	350	Rebuild east wall from ground; anchor all walls and rebuild chimneys	
14	East Side Tregman	J. H. Donahoe, Dwelling	Frame	Tin	35	18	22	Good	Good	Good	Good	Rebuilt	50	Chimneys now have terra cotta tops; O K	