
GLENWOOD CEMETERY

To: Dick Ambrus
From: Martha Peterson
Subject: Estrada Monument Restoration Work
Date: October 12, 2005

I've attached photographs of the work the Estradas did last Saturday. They did an excellent job leveling the coping on the Woodhead lot, but the work on the lot is not complete because they had no way to handle the monument that needs resetting. As you can see, the rest of the work I found for them was very low priority leveling of in-ground markers, none of them on highly visible lots.

I've been investigating with Jeff whether the Estradas could use Glenwood's chain hoist to handle heavier pieces, and Jeff has decided it's not feasible because there is no way to move the stone away from the base after it is raised and it is too dangerous to work under the stone.

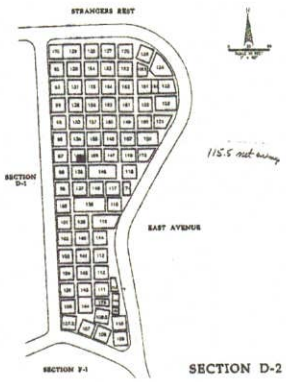
I've identified some cradles the Estradas can repair without lifting equipment, but many of the cradles that need work have markers that are too large to lift by hand. This means, as in the case of the Woodhead lot, that Mario will have to come back later to finish the lot. I wonder if it makes sense to do the work piecemeal and risk damage to the completed portion while the heavy work is being done. I'd like to hear your thoughts.

MP

Attachments

*Keep them busy
without hoist
per RAA
10-12-05*

MONUMENT RESTORATION PROJECT

Priority Status	Low (visibility) See below	Lot Purchaser Purchase Date Deed of Perpetuity Contact Last Burial	WOODHEAD, John 1891 Yes None 1896	
Section Lot No. Description	D 135 SE¼			
Work Performed	<p>The marble coping had sunk and was buried on the southwest corner. The beam of the coping was cracked behind the monument and a section approximately 2' long was missing.</p> <p>The missing piece of coping was found buried on the lot and was recovered. The four corner posts and the reassembled coping were leveled and reset on a new foundation.</p>			
Work To Be Completed	<p>A marble monument, 52" high x 20" x 10" is relatively plumb (1° north), but it is sliding on its base and overhanging it by approximately 1" on the northwest corner.</p>			



BEFORE: The marble coping has sunk and is buried on the southwest corner. The beam of the coping is cracked behind the monument and a section approximately 2' long is missing.



AFTER: The missing piece of the coping has been recovered and the four posts and the entire coping has been leveled and reset on a new foundation.



BEFORE: The monument is sliding on its base and overhanging the northwest corner approximately 1".

To be scheduled

AFTER:

MONUMENT RESTORATION PROJECT

Priority Status	Low (visibility)	Lot Purchaser Purchase Date Deed of Perpetuity Contact Last Burial	SCHMIDT, Christine 1881 No None	
Section Lot No. Description	D 101 W½			
Work Performed	An in-ground granite marker had begun sinking. The marker was raised, leveled and reset on a new foundation			
Work To Be Completed	TWO SMALL CRADLES AND MONUMENTS ON THE LOT NEED REASSEMBLY, RESETTING AND CLEANING.			



BEFORE: An in-ground granite marker had begun sinking.




AFTER: The marker has been raised, leveled and reset on a new foundation

TAKE "BEFORE" PHOTOS OF CRADLES AND MONUMENTS

BEFORE:

AFTER:

MONUMENT RESTORATION PROJECT

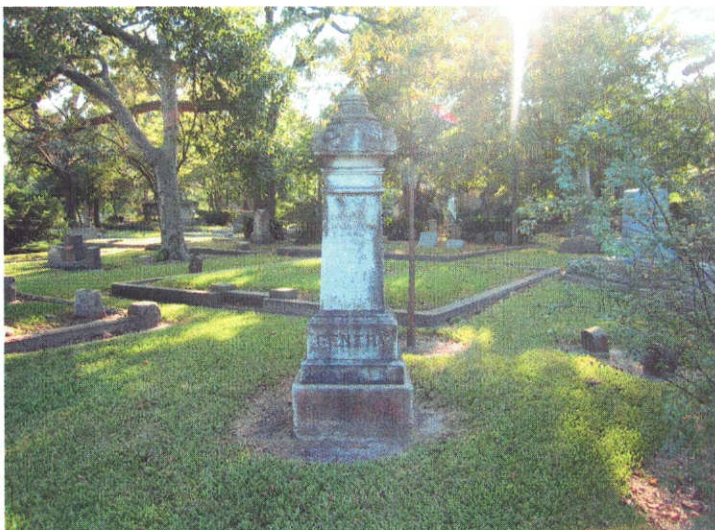
Priority Status	Medium (visibility) In progress	Lot Purchaser Purchase Date Deed of Perpetuity Contact Last Burial	GENTRY, Mary F. 1879 Yes None 1934	
Section Lot No. Description	F 017 400 s.f.			
Work Performed	The two small marble markers were sunken and tilted. The two small markers were raised, leveled and reset on new foundations.			
Work To Be Completed	The large marble monument will be checked for stability and, when any necessary leveling work is completed, the entire lot will be cleaned.			



BEFORE: The two small marble markers are sunken and tilted.



AFTER: The two small markers have been raised, leveled and reset on new foundations.




BEFORE: The large marble monument will be checked for stability and, when any necessary leveling work is completed, the entire lot will be cleaned.

To be scheduled

AFTER:

MONUMENT RESTORATION PROJECT

Priority Status	Complete	Lot Purchaser Purchase Date Deed of Perpetuity Contact Last Burial	BERING, Henry J. 1926 Yes (SPECIAL CARE*) None 1950 *Paid by Bank of America	
Section Lot No. Description	F 007.5 400 s.f.			
Work Performed	<p>A raised, flat granite marker for Henry Bering was sinking 4° north.</p> <p>The marker was raised level with the other marker on the lot and reset on a new foundation.</p>			
Work To Be Completed	None.			SECTION F-1

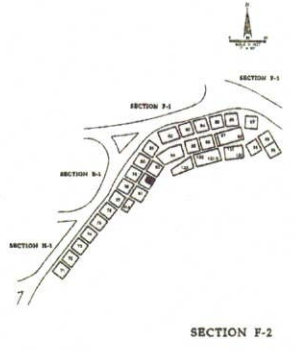


BEFORE: A raised, flat granite marker for Henry Bering was sinking 4° north.



AFTER: The marker was raised level with the other marker on the lot and reset on a new foundation.

MONUMENT RESTORATION PROJECT

Priority Status	Very low (visibility) In progress (Estrada)	Lot Purchaser	RAMSDELL, Ethelyn	
Section	F	Purchase Date	1931	
Lot No.	092	Deed of Perpetuity	Yes	
Description	NE¼	Contact	None	
		Last Burial	1937	
Work Performed	Two in-ground markers were sinking. The two markers were raised, leveled and reset on new foundations.			
Work To Be Completed	THE SECOND MARKER HAS NOT BEEN DONE. RETAKE "AFTER" PHOTO.			



BEFORE: Two in-ground markers are sinking.



AFTER: The markers have been raised, leveled and reset on new foundations.

GLENWOOD CEMETERY

To: Dick Ambrus
From: Martha Peterson
Subject: Monument Restoration
Date: October 20, 2005

FILE COPY

D-150 E½



BEFORE



AFTER

D-150 E½: Six marble posts, 40' marble coping, and entrance threshold were leveled and reset on poured foundation. 36 man hours; cost to Glenwood, \$869.45.

D-135 SE¼



BEFORE



AFTER

D-135 SE¼: Four marble posts, 40' marble coping (24" found buried beneath surface) were leveled and reset on a dry foundation. There was no entrance threshold. 12 man hours; cost to Glenwood, \$185.40.