

GLENWOOD CEMETERY HISTORIC PRESERVATION FOUNDATION


RODRIGUEZ MONUMENT RESTORATION PROJECTS

(Identified, Not Scheduled)

	Lot Name	Section	Lot No.	Lot Description	Begin Date	End Date	Actual Cost to Date
1.	Markle, C. N.	D	107	W 1/2 - ACTIVE CONTACT		Sunken coping	
2.	Woodhead	D	135	SE 1/4		Reset monument	
3.	Borgstedt	D	136	SW 1/4		Stucco coping	
4.	Williams, Charles B.	D	175			Level lot and coping	
5.	Gentry, Mary F.	F	017			Check central monument	
6.	Shannon, Joe	F	019	NW 1/2		Stucco coping	
7.	Simmler, E.	F	020			Heavy coping	
8.	Locascio, Rosa	F	022	E 1/2		Heavy coping	
9.	Small, Mrs. A. B.	F	043	500 s.f.		Stucco coping	
10.	Perry, W. J.	F	057			HORRIBLE	
11.	Lubbock, T. U.	F	059			Coping and markers	
12.	Hamblen, E. P.	F	085			Heavy coping	
13.	Wettermark, A.	WA	253	1,000 s.f.		Level very tall monument	
14.							
15.							

*Add Sullivan
in G.
Astrada*

Markle, C.N.
D-107 W 1/2
1940
DOP yrs
Contact in Houston
(since 2003)


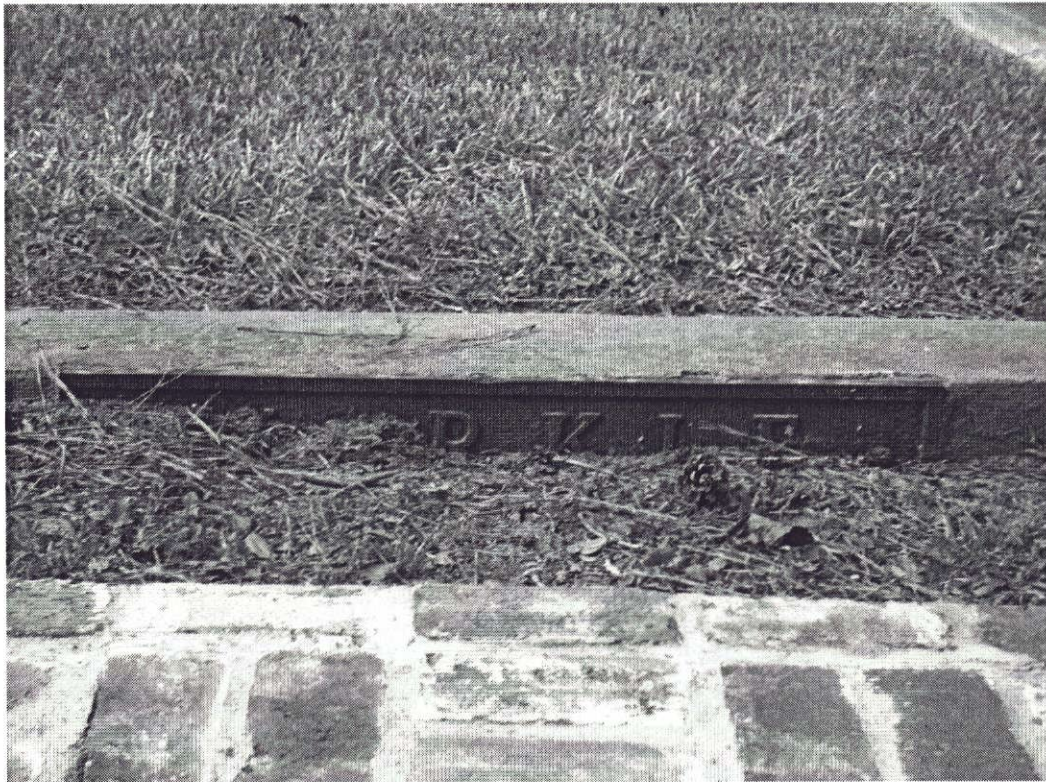


*Coping
surk*



MONUMENT RESTORATION PROJECT

Priority Status	Low (visibility) See below	Lot Purchaser	WOODHEAD, John
Section	D	Purchase Date	1891
Lot No.	135	Deed of Perpetuity	Yes
Description	SE¼	Contact	None
		Last Burial	1896
Work Performed	The marble coping had sunk and was buried on the southwest corner. The beam of the coping was cracked behind the monument and a section approximately 2' long was missing. The missing piece of coping was found buried on the lot and was recovered. The four corner posts and the reassembled coping were leveled and reset on a new foundation.		
Work To Be Completed	A marble monument, 52" high x 20" x 10" is relatively plumb (1° north), but it is sliding on its base and overhanging it by approximately 1" on the northwest corner.		

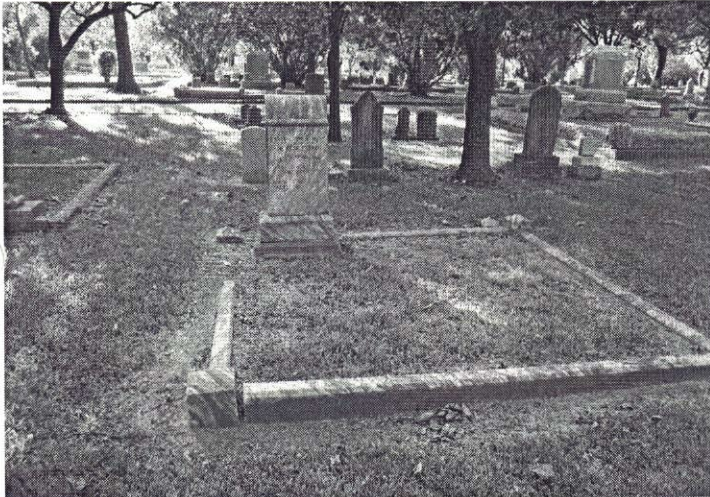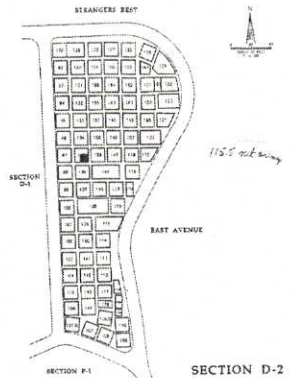

BEFORE: The marble coping has sunk and is buried on the southwest corner. The beam of the coping is cracked behind the monument and a section approximately 2' long is missing.



AFTER: The missing piece of the coping has been recovered and the four posts and the entire coping has been leveled and reset on a new foundation.



BEFORE: The monument is sliding on its base and overhanging the northwest corner approximately 1".

To be scheduled

AFTER:

Borgsleet
D-136 SW 1/4

See project sheet




Coping

Williams, Charles B
D-175 (200 sf)
1905
no DOP
no contact



Level lot + markers

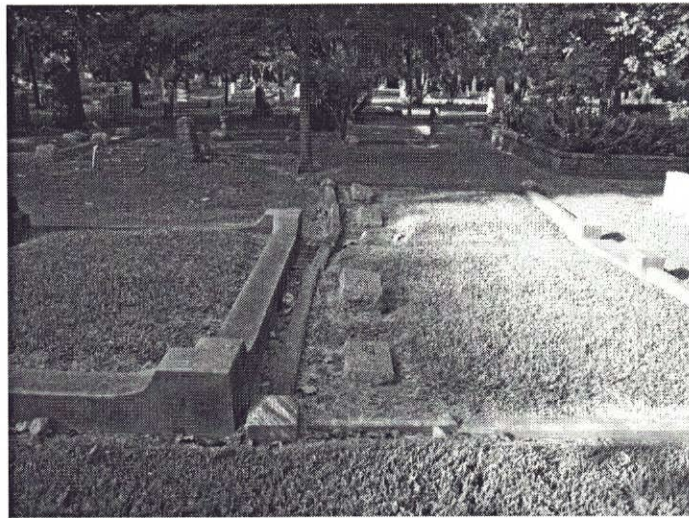

Straighten copy

MONUMENT RESTORATION PROJECT

Priority Status	Medium (visibility) In progress	Lot Purchaser GENTRY, Mary F. Purchase Date 1879 Deed of Perpetuity Yes Contact None Last Burial 1934
Section Lot No. Description	F 017 400 s.f.	
Work Performed	The two small marble markers were sunken and tilted. The two small markers were raised, leveled and reset on new foundations.	
Work To Be Completed	The large marble monument will be checked for stability and, when any necessary leveling work is completed, the entire lot will be cleaned.	



SECTION F-1



BEFORE: The two small marble markers are sunken and tilted.



AFTER: The two small markers have been raised, leveled and reset on new foundations.



BEFORE: The large marble monument will be checked for stability and, when any necessary leveling work is completed, the entire lot will be cleaned.

To be scheduled

AFTER:

Shannon, Joe
F-019 NW 1/2
1886
DOP Yes
no contact
Last 1938



only east side of
concrete coping.

Simmler, E.

F-020

1879

DOP Yes

no contact

Last: 1963





Locascio, Rosa Lanzio

F-022 E 1/2

1912

DOP Yes
no contact

Last: 1937

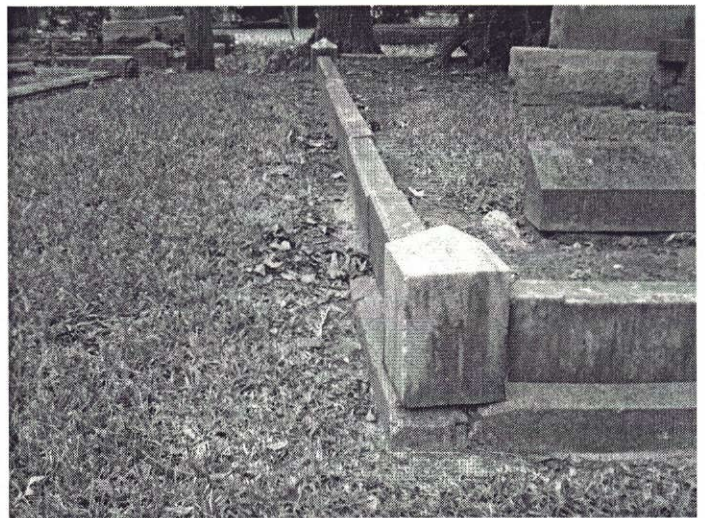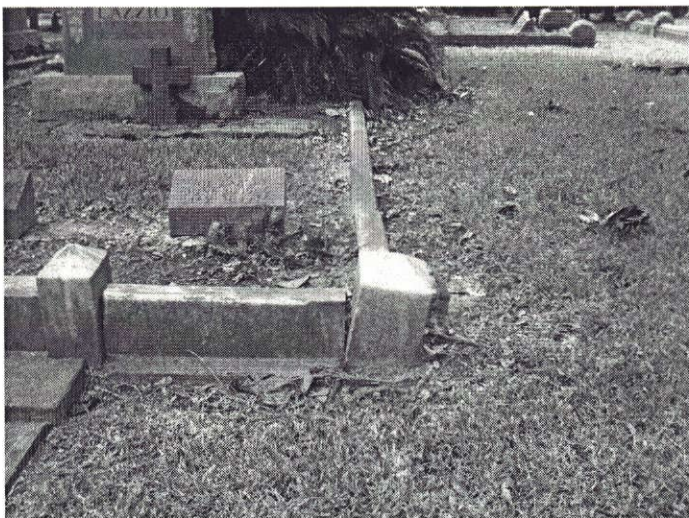

Small, Mrs. A.B.
F-043 (500 sf)
1879
DOP 10
no contact
Last 1889



Four ~~unmarked~~ unmarked graves in
S-Sp. Probe for markers.

Replace or remove coping.

Perry, W.G.
F-057
1879
No DOP
No contact



Copies
made
1'+
(no roots
evident)



Broken
statue

Lubbock, T. U.


F-059

1880

DOP Yes

Contact: Tarrant Lindley

Last: 1972

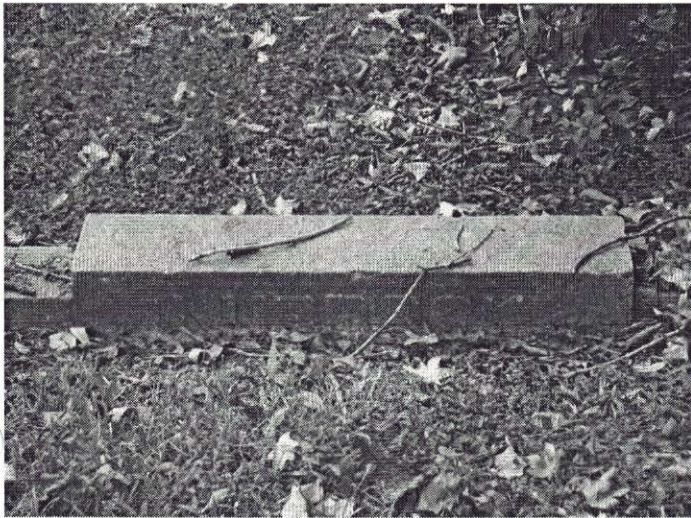

Hamblen, EP

F 085

1872


DOP yes

no contact



MONUMENT RESTORATION PROJECT

Priority	High (visibility; danger of falling)	Lot Purchaser Purchase Date Deed of Perpetuity Contact Last Burial	WETTERMARK, A. 1873 Yes None 1906
Status			
Section Lot No. Description	West Avenue 253 1,000 s.f.		
Work Performed			
Work To Be Completed	A white marble monument, approximately __' tall, is set on a rubble foundation and is tilting __° __ and __° __. One of two urns approximately ____" tall is missing from monument and may be buried on lot. Monument will be leveled on a new foundation and cleaned. An effort will be made to find the missing urn.		

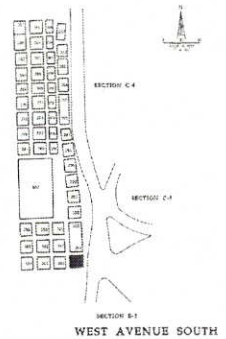

BEFORE:

AFTER:



BEFORE:

AFTER:

Sullivan, M.A.

G-067 w/12

1890

No DOP

No Contact

Last 1900

Marker for Edward

P. Larkin (1900) is

leaning 10° S + 10° E.

Marble - 51" tall on

18 1/2 x 18 1/2 base

Gravestone is missing

