



DOOR	SIZE	TYPE	FIN	CONFIG.	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D1-G01	3'-6" x 8'-0"	SINGLE IN-SUNG	E	OPEN TOP OVER PANEL & SIDELITE	FAIR	NONE	BROKEN	WOODEN DEAD-BOLT, EXISTING KNOB	1, 3, 4, 16

NOTE: DOOR TO BE RE-HINGED TO LEVEL IN FRAME, REMOVE FROM FRAME AND REPAIR DAMAGE TO BOTTOM OF STILES




DOOR	SIZE	TYPE	FIN	CONFIGURATION	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D2-G01	2'-1 1/2" x 6'-0" x 1'-2"	SINGLE IN-SUNG	E	VERTICAL BOARDS	FAIR	WOOD	N/A	EXISTING	1, 2, 9, 10, 16




DOOR	SIZE	TYPE	FIN	CONFIG.	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D1-G04	3'-0 3/4" x 7'-1 1/2"	SINGLE IN-SUNG	E	4-PANEL	FAIR	NONE	N/A	NEW RUBBER & GLASS BOLTS	1, 2, 4, 10, 17, 18


DOOR ELEVATIONS
SCALE: 1/2" = 1'-0"

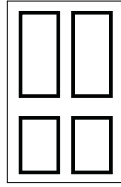


DOOR	SIZE	TYPE	FIN	CONFIG.	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D2-G02	3'-0 3/4" x 7'-1 1/2"	SINGLE IN-SUNG	E	4-PANEL	GOOD	HANDLES/BRONZE	N/A	NEW GLASS BOLT LARGES ORNATE TRIM, BRONZE TRIM	1, 2, 4, 9, 10, 17, 18




DOOR	SIZE	TYPE	FIN	CONFIG.	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D1-G02	2'-0 3/4" x 6'-0" x 1'-2"	SINGLE OUT-SUNG	E	4-PANEL	POOR	WOOD	WOOD	NEW GLASS BOLT ONLY ONE	1, 2, 4, 10, 14, 16



DOOR	SIZE	TYPE	FIN	CONFIG.	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D2-G01	3'-0" x 6'-2"	SINGLE IN-SUNG	E	VERTICAL BOARDS	FAIR	HANDLES	N/A	EXISTING KNOB NEW GLASS BOLT	1, 2, 10, 16, 17, 18



DOOR	SIZE	TYPE	FIN	CONFIG.	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D1-G03	3'-0 3/4" x 6'-1 1/2"	SINGLE IN-SUNG	N	4-PANEL	GOOD	CONCRETE	N/A	NEW GLASS BOLT OUT, NOT STRAP HINGED IN	1, 4, 9, 14



DOOR	SIZE	TYPE	FIN	CONFIGURATION	GENERAL COND.	ILL.	THRESH-HOLD	HARDWARE	NOTES
D1-G02	3'-0 3/4" x 6'-2"	SINGLE IN-SUNG	E	VERTICAL BOARDS	FAIR	HANDLES/BRONZE	N/A	NEW HANDLE & GLASS BOLT	1, 2, 4, 9, 10, 16

KEY
1. GENERAL PAINTING: DOOR, JAMB, HARDWARE, FRAME- EXTERIOR ONLY
2. EPOXY REPAIRS VISIBLE
3. HISTORIC DOOR HARDWARE TO BE REPAIRED & RETAINED
4. REPLACEMENT DOOR HARDWARE TO BE RETAINED
5. DOOR RECENTLY REPAIRED/REPLACED
6. NOT USED
7. THRESH-HOLD REPAIRS REQUIRED
8. BROWNSTONE SILL SPALLING, REPAIR W/ JAHN
9. SILL CRACKED/ NOTCHED
10. WOOD JAMB REPAIRS FAILING
11. SIDELITE GLASS CRACKED
12. SIDELITE(S) NEED TO BE REPLACED W/ RESTORATION GLASS
13. SIDELITE SASHES NEED REGLAZING
14. DOOR PANEL TRIM MISSING/DAMAGED
15. BRONZE WEATHERSTRIPPING PRESENT
16. VISIBLE WATER DAMAGE/ ORGANIC GROWTH
17. NAIL HOLES/ NOTCHES FOR OLD HARDWARE PRESENT
18. DOOR FRAME DAMAGED

Glenn Keyes
Architects

12 Middleton Street
Charleston, SC 29403
Fax: (843) 722-1140


RESTORATION OF:
AIKEN-RHETT HOUSE
48 ELIZABETH STREET
CHARLESTON, SC
FOR THE
HISTORIC CHARLESTON FOUNDATION

DOOR ASSESSMENT


PROJECT NUMBER
0523

DRAWING DATE
1/20/06


SHEET NUMBER
A502



DOOR	SIZE	TYPE	S/N	CONFIG.	GENERAL COND.	SILL	THRESHOLD	HARDWARE	NOTES
D4-M1	3'-0 3/4" X 7'-9"	SINGLE OUT-SWING	RE-USED	2-PANEL	GOOD	WOOD	WOOD	HISTORIC KNOB	1,3,5,16

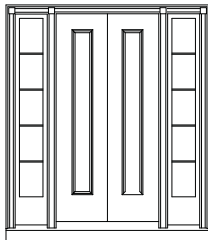


DOOR	SIZE	TYPE	S/N	CONFIG.	GENERAL COND.	SILL	THRESHOLD	HARDWARE	NOTES
D9-M9	3'-6" X 7'-0"	DOUBLE IN-SWING	II	1-PANEL DR W/ SDELTA	FAIR	WOOD	WOOD	EDGINGS	1,3,4,5,13,14,17

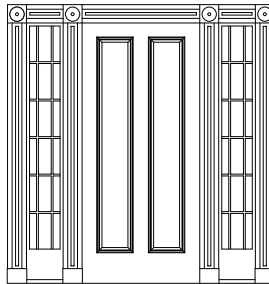

DOOR	SIZE	TYPE	S/N	CONFIG.	GENERAL COND.	SILL	THRESHOLD	HARDWARE	NOTES
D3-204	3'-0 3/4" X 8'-0 3/4"	SINGLE IN-SWING	II	2-PANEL W/ SDELTA	FAIR	WOOD	WOOD	EDGINGS	1,3,4,13,16

NOTE: EDGINGS RE LOCK TO BE RESTORED, PATCH THRESHOLD WHERE REQUIRED



DOOR	SIZE	TYPE	S/N	CONFIG.	GENERAL COND.	SILL	THRESHOLD	HARDWARE	NOTES
D4-208	3'-7 1/2" X 5'-4 1/2"	DOUBLE IN-SWING	II	4-LIGHT FRENCH DR	FAIR	WOOD	WOOD	EDGINGS	1,3,4,5,12,14,16 DOOR HAS EXTERIOR SHUTTERS NEED RESTORATION

- KEY
1. GENERAL PAINTING: DOOR, JAMB, HARDWARE, FRAME- EXTERIOR ONLY
 2. EPOXY REPAIRS VISIBLE
 3. HISTORIC DOOR HARDWARE TO BE REPAIRED & RETAINED
 4. REPLACEMENT DOOR HARDWARE TO BE RETAINED
 5. DOOR RECENTLY REPAIRED/REPLACED
 6. NOT USED
 7. THRESHOLD REPAIRS REQUIRED
 8. BROWNSTONE SILL SPALLING, REPAIR W/ JAHN
 9. SILL CRACKED/ NOTCHED
 10. WOOD JAMB REPAIRS FAILING
 11. SIDELITE GLASS CRACKED
 12. SIDELITE(S) NEED TO BE REPLACED W/RESTORATION GLASS
 13. SIDELITE SASHES NEED REGLAZING
 14. DOOR PANEL TRIM MISSING/DAMAGED
 15. BRONZE WEATHERSTRIPPING PRESENT
 16. VISIBLE WATER DAMAGE/ ORGANIC GROWTH
 17. NAIL HOLES/ NOTCHES FOR OLD HARDWARE PRESENT
 18. DOOR FRAME DAMAGED

DOOR ELEVATIONS
SCALE 1/2" = 1'-0"

Glenn Keyes
Architects

12 Middleton Street
Charleston, SC 29403
Tel: (843) 722-1140
Fax: (843) 722-1140


RESTORATION OF:
AIKEN-RHETT HOUSE
48 ELIZABETH STREET
CHARLESTON, SC
FOR THE
HISTORIC CHARLESTON FOUNDATION

DOOR ASSESSMENT

PROJECT NUMBER
0523


DRAWING DATE
1/20/06

SHEET NUMBER
A503

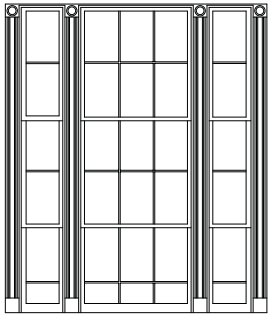


WINDOW 8'-0"X6'-6"	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE L R	SHUTTER DOG TYPE L R	NOTES
W-402	TH	6/6/6	FAIR	UD	N/A	3 3	EXISTING	6 6	1,2,7,10,12,13,14,17,20
W-406	TH	6/6/6	FAIR	UD	N/A	3 3	EXISTING/ REPLACENT	6 6	1,2,7,10,12,13,14,17,19,20
W-406	TH	6/6/6	FAIR	UD	N/A	TO BE KEPT AS-IS	EXISTING	N/A	TO BE MAINTAINED UN-RESTORED AS AN ARTIFACT
W-408	TH	6/6/6	POOR	UD	N/A	3 3	EXISTING/ REPLACENT	N/A	1,2,7,11,12,13,14,17,18,19,20,22


*NOTE REMOVE MODERN HAMP ON W-406 AND W-408




WINDOW 3'-11 1/4"X 4'-3 3/4"	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE L R	SHUTTER DOG TYPE L R	NOTES
W-401	CH FIXED	6/6	GOOD	BROWN- STONE	UD	MISSING	REQUIRED	REPLACE W/ G	1,3,8,11,22



WINDOW 3'-5 1/4"X 4'-1 1/2"	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE L R	SHUTTER DOG TYPE L R	NOTES
W-405	FRAMED OPENING		FAIR	UD	N/A	N/A	N/A	N/A	RESTORE RICH BARS REPAIR FRAME

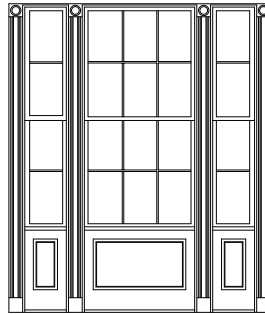

WINDOW 8'-0"X6'-6"	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE L R	SHUTTER DOG TYPE L R	NOTES
W-402	CH	6/6	FAIR	WOOD	WOOD	3 3	EXISTING	1 1	1,2,7,10,12,13,14,17,22
W-408	CH	6/6	POOR	WOOD	WOOD	1 1	REPLACENT	MISSING	1,7,10,14,16,22,23,24





*NOTE ALL GALLERY WINDOWS AND SHUTTERS HAVE BEEN RESTORED,
ALL WORK TO BE LIMITED TO EXTERIOR PAINTING ONLY

WINDOW 9'-13 1/4"X7'-6"	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE L R	SHUTTER DOG TYPE L R	NOTES
W-409	CH	6/6	GOOD	BROWN- STONE	UD	2 2	REPLACENT	2 2	1,14,15,21,22,24,25
W-409	CH	6/6	GOOD	BROWN- STONE	UD	2 2	REPLACENT	2 ; MISSING	1,14,21,22,24,25
W-409	CH	6/6	GOOD	BROWN- STONE	UD	2 2	REPLACENT	2 2	1,15,21,22,24,25
W-409	CH	6/6	GOOD	BROWN- STONE	UD	1 1	REPLACENT	MISSING, 2	1,15,21,22,24,25

GENERAL NOTE:
WEATHERSTRIPPING REPAIRS FROM SASH ON W-409 & W-408
CONDENATION STAND ON WINDOW INTERIOR LOWER SASHES

SHUTTER STATUS KEY:
1. EXISTING REPLACEMENT
2. RESTORED
3. EXISTING- RESTORATION REQUIRED
4. MISSING- MATCH EXISTING

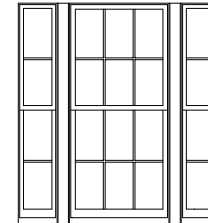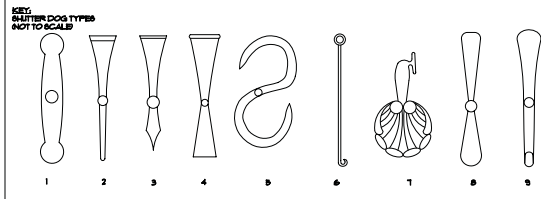

WINDOW 6'-0"X7'X 7'-6"X7'	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE L R	SHUTTER DOG TYPE L R	NOTES
W-403	CH	6/6	GOOD	BROWN- STONE	UD	2 2	REPLACENT	6 6	1,2,7,10,12,14,16,22 CUT STONE & DETERIORATED PT 4 REPLACE REST OF SILL



WINDOW 2'-4 1/4"X 5'-8 1/2"	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE L R	SHUTTER DOG TYPE L R	NOTES
W-406	CASE- MENT	VI	GOOD	STUC.	UD	3 3	REPLACENT	N/A	1,12,17
W-406	CASE- MENT	VI	GOOD	STUC.	UD	3 3	REPLACENT	N/A	1,3,12,17 W/REINFORCED BALL MISSING
W-406	CASE- MENT	VI	GOOD	STUC.	UD	3 3	REPLACENT	N/A	1,12,17
W-406	CASE- MENT	VI	GOOD	STUC.	UD	3 3	REPLACENT	N/A	1,12,18,17
W-406	CASE- MENT	VI	GOOD	STUC.	UD	3 3	REPLACENT	N/A	1,2,17,18,17

KEY
1. GENERAL PAINTING:
2. SASHES, FRAMES, SILL-EXTERIOR ONLY; SHUTTERS & HARDWARE
3. SHUTTER REPAIRS REQUIRED
4. SHUTTER HARDWARE MISSING
5. SHUTTERS MISSING
6. LOUVERS NEED REPLACING
7. SHUTTER HARDWARE NEEDS TO BE PAINTED
8. SUBSILL ROTTED
9. SUBSILL CRACKED/ NOTCHED
10. WINDOW OR SIDELIGHT PULLEY ROPE MISSING OR DAMAGED
11. LITES CRACKED
12. LITE(S) NEED TO BE REPLACED W/RESTORATION GLASS
13. WOOD JAMB REPAIRS FAILING
14. WINDOW STOP OR TRACK MISSING OR DAMAGED
15. SILL ROTTED
16a. FILL BROWNSTONE SILL VOIDS AND FISSURES WITH JAHN
16b. REGARVE BROWNSTONE SILL TOP TO FEATHER EDGES
16c. REPLACE BROWNSTONE SILL
16d. OTHER BROWNSTONE SILL REPAIRS REQUIRED AS NOTED
17. SASHES NEED REGLAZING
18. SASH RAIL FAILING
19. SASH MUNTIN DAMAGED OR NEEDS REPLACING
20. SASH REPAIR FAILING
21. ZINC/OTHER MODERN WEATHERSTRIPPING PRESENT
22. WINDOW EXTERIOR RECENTLY REPAINTED/ REGLAZED
23. WATER DAMAGE SHUTTER SILL &/OR WINDOW
24. GENERAL SHUTTER REPAIRS RECENTLY COMPLETED/
NEW SHUTTERS CONSTRUCTED
25. SHUTTERS REQUIRE FAUX GRAINING

GENERAL NOTES:
1. ALL INTERIOR FINISHES TO BE RETAINED
2. MODERN SASH LOCKS, WHERE PRESENT, TO BE RETAINED
3. SUBSEQUENT TO TOP SASH REMOVAL FOR REPAIRS,
SASH TO BE FIXED IN PLACE
4. ALL PHILLIPS HEAD SCREWS ON SHUTTER HARDWARE
WHERE PRESENT, TO BE REPLACED WITH FLATHEAD SCREWS

WINDOW ELEVATIONS
SCALE 1/2" = 1'-0"


Glenn Keyes
Architects

12 Middleton Street
Charleston, SC 29403
Fax: (843) 722-1140

RESTORATION OF:
AIKEN-RHETT HOUSE
48 ELIZABETH STREET
CHARLESTON, SC
FOR THE
HISTORIC CHARLESTON FOUNDATION


WINDOW ASSESSMENT

PROJECT NUMBER
0523
DRAWING DATE
1/20/06
SHEET NUMBER
A504



SHUTTER STATUS KEY:
1. EXISTING REPLACEMENT
2. RESTORED
3. EXISTING- RESTORATION REQUIRED
4. MISSING- MATCH EXISTING

KEY:
SHUTTER DOG TYPES
NOT TO SCALE

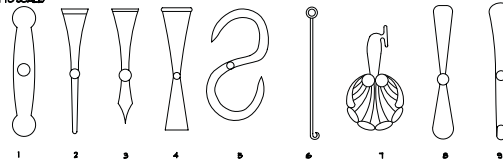

KEY

- GENERAL NOTES:**
1. ALL INTERIOR FINISHES TO BE RETAINED
 2. MODERN SASH LOCKS, WHERE PRESENT, TO BE RETAINED
 3. SUBSEQUENT TO TOP SASH REMOVAL FOR REPAIRS, SASH TO BE FIXED IN PLACE
 4. ALL PHILLIPS HEAD SCREWS ON SHUTTER HARDWARE, WHERE PRESENT, TO BE REPLACED WITH FLATHEAD SCREWS




RESTORATION OF:
AIKEN-RHETT HOUSE
408 ELIZABETH STREET
CHARLESTON SC
FOR THE
HISTORIC CHARLESTON FOUNDATION

WINDOW ASSESSMENT

PROJECT NUMBER	0523
DRAWING DATE	1/20/06
SHEET NUMBER	4505




WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-001	FIXED	1 PANE	FAIR	BROWN STONE	WOOD	4 4	REQUIRED	REPLACE W/RS	1,2,3,5,6,14,23 BOTH ON RIGHT, PLUS LOWER LEFT PANTLE REQD.

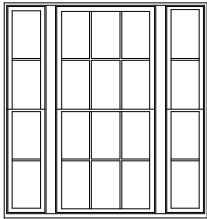

NOTE: NO WORK REQUIRED ON EXISTING INTERIOR SHUTTERS


WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-004	DN	9/9	FAIR	WOOD	N/A	SEE NOTE ABOVE	EXISTING	N/A	1,2,4,6,12,13,16,17,20,21,22



WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-001	CASEMENT	3 LITE	FAIR	BROWN STONE	WOOD	N/A	N/A	N/A	1,2,17 RESTORE IRON GRILL & REMOVE MODERN SCREEN




WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-001	CASEMENT	1 LITE	GOOD	BROWN STONE	WOOD	N/A	N/A	N/A	RESTORE CAST IRON GRILL & REINSTALL MISSING HALF OF GRILL




WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-005	DN	6/6	FAIR	BROWN STONE	WOOD	SEE NOTE	EXISTING	N/A	1,3,12,14,15,20
W-006	DN	6/6	FAIR	BROWN STONE	WOOD	4 4	REQUIRED	N/A	1,2,3,5,6,14,15,17,23 BOTH LOWER PANTLES REQD.

NOTE: SHUTTER HAS BEEN REMOVED TO ACCOMMODATE SECTION OF MECHANICAL SYSTEM




NOTE: BOTH WINDOWS ARE MODERN, FIXED IN PLACE & HAVE OPAQUE GLASS LITES

WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-005	DN	6/6	GOOD	BROWN STONE	WOOD	N/A	N/A	N/A	1,3,5
W-006	DN	6/6	GOOD	BROWN STONE	WOOD	N/A	N/A	N/A	1,3,5




WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-002	FIXED	1 PANE	GOOD	STUC.	WOOD	5 5	EXISTING	MISSING	PAINT & REPAIR SHUTTER EXTERIORS ONLY
W-002	FIXED	1 PANE	GOOD	STUC.	WOOD	5 5	EXISTING	MISSING	PAINT & REPAIR SHUTTER EXTERIORS ONLY

KEY:
SHUTTER DOG TYPES
NOT TO SCALE

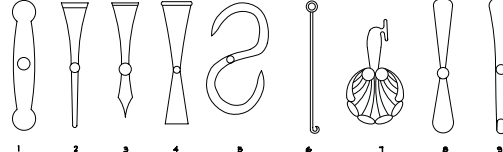


GENERAL NOTES:

- ALL INTERIOR FINISHES TO BE RETAINED
- MODERN SASH LOCKS, WHERE PRESENT, TO BE RETAINED
- SUBSEQUENT TO TOP SASH REMOVAL FOR REPAIRS, SASH TO BE FIXED IN PLACE
- ALL PHILLIPS HEAD SCREWS ON SHUTTER HARDWARE WHERE PRESENT, TO BE REPLACED WITH FLATHEAD SCREWS



WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
ATTC	SEMI-CIRCULAR WINDOW	8 LITE ARCH-CIRCULAR	FAIR	BROWN STONE	WOOD	N/A	N/A	N/A	EXCISE EXTERIOR REPAIRS ONLY 1,14,17,18,21 REPAIR WOOD FRAME

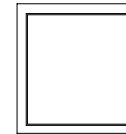

WINDOW	TYPE	SASH CONFIG.	GENERAL COND.	SILL	SUB-SILL	SHUTTER STATUS L R	SHUTTER HARDWARE	SHUTTER DOG TYPE	NOTES
W-002	FIXED	1 PANE	GOOD	STUC.	WOOD	5 5	ORIGINAL	N/A	1,14,17,18,21,22,23 NOT ACCESSIBLE FROM INTERIOR, REPAIR SHUTTER EXTERIORS ONLY
W-002	FIXED	1 PANE	GOOD	STUC.	WOOD	5 5	ORIGINAL	N/A	1,14,17,18,21,22,23 NOT ACCESSIBLE FROM INTERIOR, REPAIR SHUTTER EXTERIORS ONLY
W-003	LOW OPENING	NONE	GOOD	WOOD	N/A	N/A	N/A	N/A	PAINT EXTERIOR ONLY

SHUTTER STATUS KEY:

- EXISTING REPLACEMENT
- RESTORED
- EXISTING- RESTORATION REQUIRED
- MISSING- MATCH EXISTING

KEY:

- GENERAL PAINTING:
- SASHES, FRAMES, SILL- EXTERIOR ONLY; SHUTTERS & HARDWARE
- SHUTTER REPAIRS REQUIRED
- SHUTTER HARDWARE MISSING
- SHUTTER HARDWARE TO BE REPAIRED AND RETAINED
- SHUTTERS MISSING
- LOUVERS NEED REPLACING
- SHUTTER HARDWARE NEEDS TO BE PAINTED
- SUBSILL ROTTED
- SUBSILL CRACKED/ NOTCHED
- WINDOW OR SIDELIGHT PULLEY ROPE MISSING OR DAMAGED -REPLACE WHERE NECESSARY
- LITES CRACKED
- LITE(S) NEED TO BE REPLACED W/RESTORATION GLASS
- WOOD JAMB REPAIRS FAILING
- WINDOW STOP OR TRACK MISSING OR DAMAGED
- SILL ROTTED
- 16a. FILL BROWNSTONE SILL VOIDS AND FISSURES WITH JAHN
- 16b. RECARVE BROWNSTONE SILL TOP TO FEATHER EDGES
- 16c. REPLACE BROWNSTONE SILL
- 16d. OTHER BROWNSTONE SILL REPAIRS REQUIRED AS NOTED
- SASHES NEED REGLAZING
- SASH RAIL FAILING
- SASH MUNTIN DAMAGED OR NEEDS REPLACING
- SASH REPAIR FAILING
21. ZINC/OTHER MODERN WEATHERSTRIPPING PRESENT
- WINDOW EXTERIOR RECENTLY REPAINTED/ REGLAZED
- WATER DAMAGE: SHUTTER SILL &/OR WINDOW
- GENERAL SHUTTER REPAIRS RECENTLY COMPLETED/ NEW SHUTTERS CONSTRUCTED
- SHUTTERS REQUIRE FAUX GRAINING

Glenn Keyes
Architects

12 Middleton Street
Charleston, SC 29403
Box (843) 722-1140

RESTORATION OF
AIKEN-RHETT HOUSE
48 ELIZABETH STREET
CHARLESTON, SC
FOR THE
HISTORIC CHARLESTON FOUNDATION

WINDOW ASSESSMENT

PROJECT NUMBER
0523

DRAWING DATE
1/20/06

SHEET NUMBER
A506

WINDOW ELEVATIONS
SCALE 1/2" = 1'-0"