
1946

GLOBE TROTTER TRANSMITTER

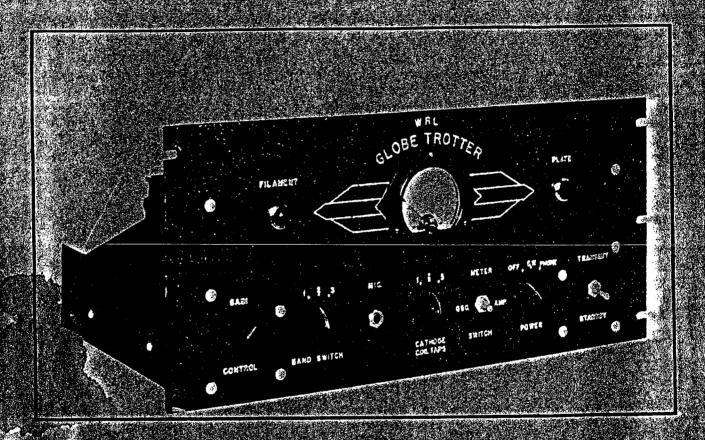

HT . MANUALS 8 801 802 2000 (2 8 0755 1004 51502 K5M0

WRL GLOBE TROTTER

GENERAL DESCRIPTION

Tube-complement: 6L6 Oscillator - 807 Final - (2) 5U4 Rectifiers - 6SJ7 Speech Amp. - 6N7 Driver - (2) 6V6 Modulators.

Power consumption 125 watts

The Globs Trotter incorporates the new hot cathode Xtal oscillator circuit which allows complete band coverage from 10 to 80 meters using only a 40 or 80 meter Xtal. A keying jack in the cathode of the oscillator allows break in operation on GW. The cathode coil switch now serves to switch one of three different Xtals into the osc grid and the Band Switch serves to switch one of three sets of coils into the osc and final plate circuits. One of the power supplies is used for the final and modulators while the other supplies the Osc, speech and driver stages. The speech stage is conventional and allows the use of a Xtal or high impedance dynamic mic. The driver is connected in parallel as are the modulators and will supply sufficient modulation to the figal stage.

Provisions have been made for an Antenna changeover relay and for remote operation of the transmitter which is explained in the tuning procedure.

TUNING PROCEDURE FOR GLOBE TROTTER


- 1. Set power switch to off position and Sw2 to Stand By.
- 2. Insert line cord provided, in receptacle of transmitter, and into a 110v. AC outlet.
- 3. Insert Mic. or key as desired.
- 4. Plug the Xtals into their respective sockets. See Coil and Xtal Chart.
- 5. Plug the desired coils into their respective sockets.
- 6. Cheak to see if tubes are in proper sockets.
- 7. Turn power switch to CW and allow one minute warm-up.
- 8. Set the Band switch and the Cathode switch to the proper position. (see coil chart).
- 9. Set meter switch to osc.
- 10 Turn on Transmit switch.
- 11 With an alignment screwdriver tune the condenser in the Osc. coil to resonance as indicated by a sharp dip in current on the meter.
- 12 Turn meter switch to Amp and tune the condenser in the final coil for resonance as indicated by a sharp dip in plate current. Always tune for minimum dip on the meter.
- 13 Turn off Transmit switch and attach the Antenna feeders to the two feed thru's at the rear of the Chassis.
- 14 Turn on the Transmit switch and again tune the final coil for minimum dip. This time it should be much higher as the final is loaded. It should be from 75 to 100 MA when fully loaded.
- 15 Turn off Transmit switch and turn power switch to Phone position allowing one minute warm-up for the tubes.
- 16 Tura on Transmit switch, advance gain approx half way for full modulation.

COIL AND KTAL CHART


BIND	KIAL & SOCKET	OSC.COIL & COCKET	FINAL COIL&	SOC.	BAND	S.V.	CATHODE	- 3\
low	40M-Xtal 3	10M.osc-Osc 3	lOM.FFina	1 3	3		3	-
MOS	40M-Xtal 3	20M.osc-0sc 3	20M.FFina	1 3	3		3	_
40M	40M-Xtal 2	40M.osc-0sc.2	40M.FFina	1 2	2	,	2	-
80M	80M-Xtal I	80M-osc-0sc.1	80M.FFina	1 1	1	· ,	1	_

For remote or push to talk operation, and ant. relay operation the following is recommended.


There are four terminals mounted on a bakelite strip at the rear of the chassis. The two terminals to the right (looking at the rear) supply 110V. AC when the Transmit switch is turned on, and to these terminals may be attached an antenna change-over relay. The two terminals to the left may be connected to a relay which can be energized by a mic. switch. The relay then acts to ground the CT of the power transformer secondaries.

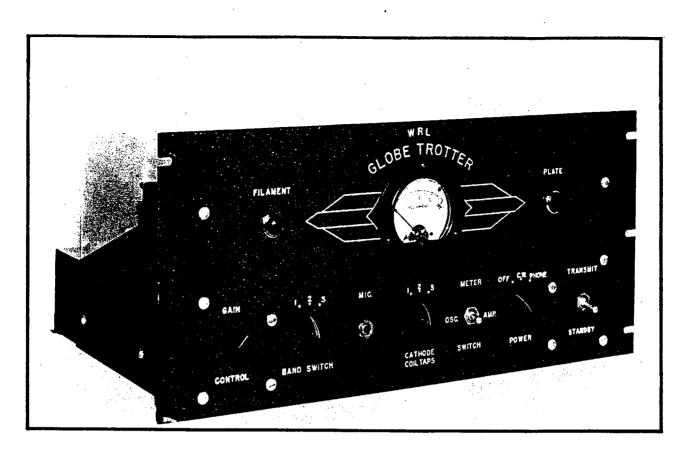


FRONT VIEW - PANEL

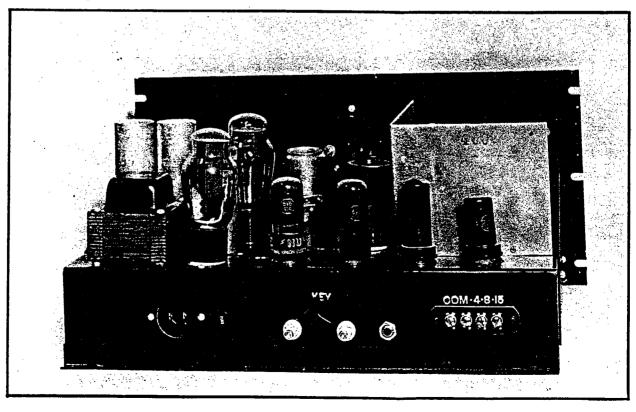


REAR VIEW

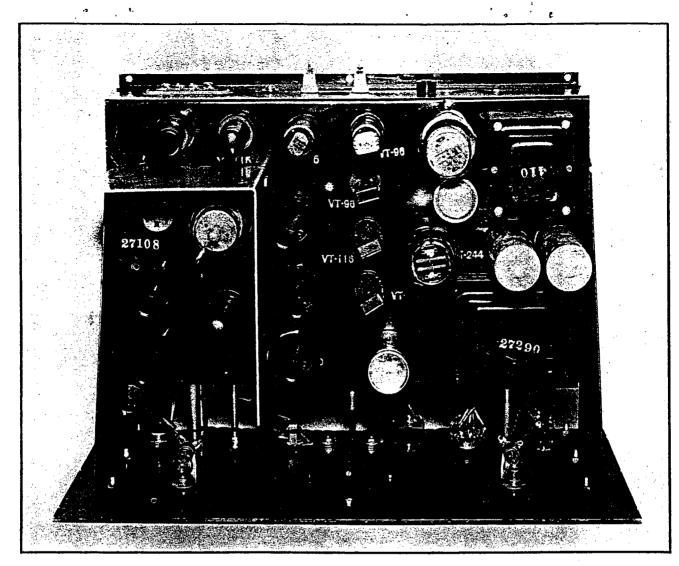



TOP VIEW

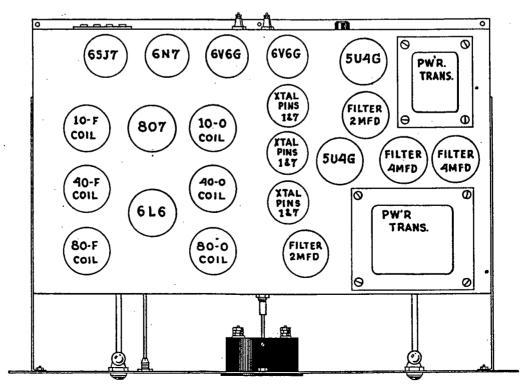


PLAN OF TOP VIEW

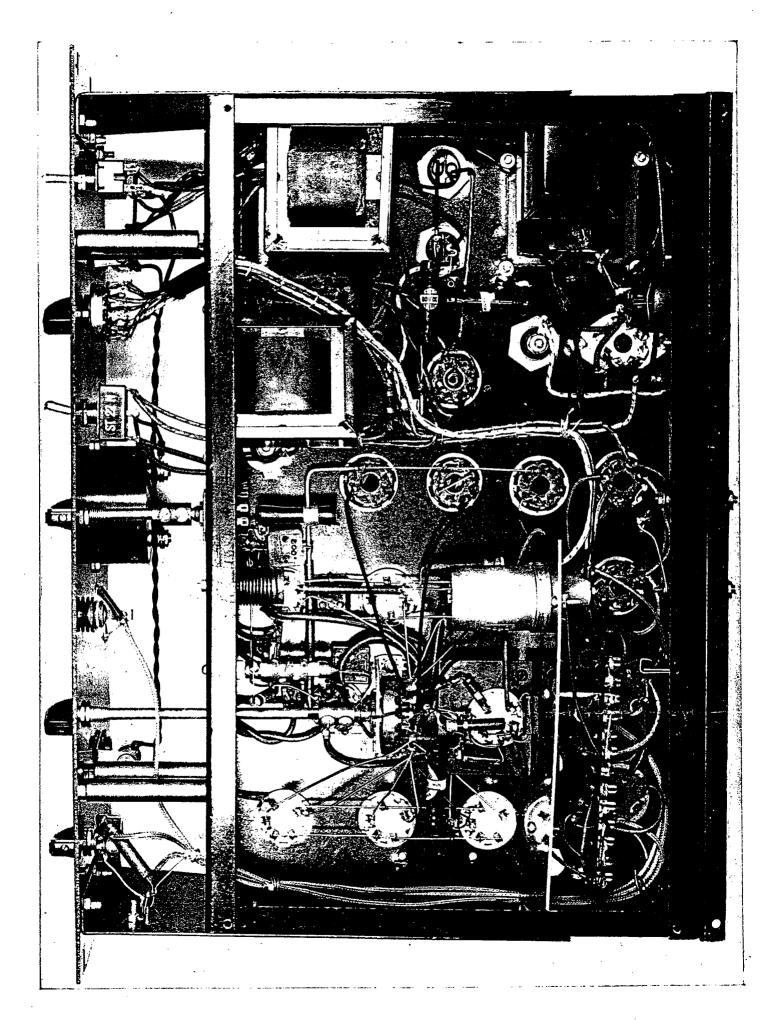



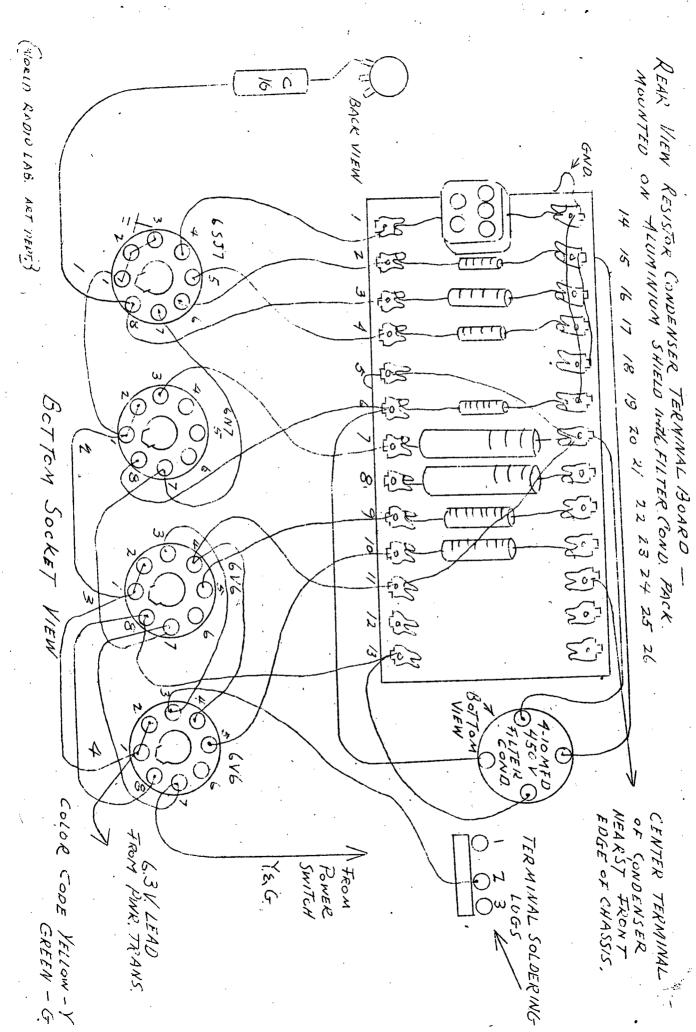

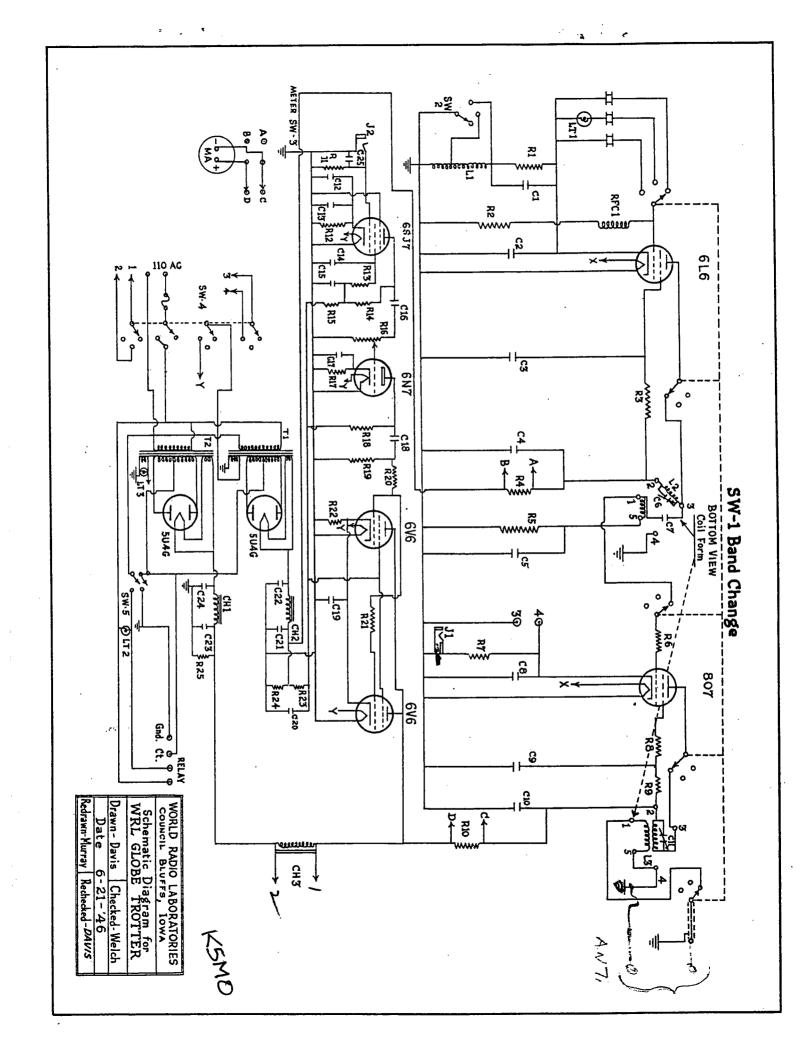

GLOBE TROTTER PARTS LIST

1-chassis 1-Panel 2-Side brackets 2-Power Transformers 2-10H-150MA chokes 1-10H-80MA choke 2-4mf-600V cond. 2-2mf-600V cond. 1-Band switch & Bracket 1-off CW phone Switch 1-DPDT meter sw. 2-110V Pilot lite assy. 1-DPDT Transmit sw. 2-S6 bulbs 2-closed ckt. jacks 1-Gain Control 6-5 Prong bakelite sockets 9-Octal bakelite sockets 1-Octal ceramic socket 1-110V. male receptacle 1-Fuse post & 3 amp fuse 2-1" feed thru insulators 1-4 screw terminal board

1-5 Prong ceramic socket and mounting plate

6-3 lug tie strips
1-1 lug tie strip
3-2 lug tie strips
1-807 shield
2-Interstage shields
1-4/10 mf-450V cond.
2-Panel bearings
1-8" extension shaft
1-3" extension shaft
2-Shaft Couplers
1-cathode sw.

1-807 plate cap
2-Harnessess
3! #16 bus wire
3! #18 solid covered wire
3! #20 stranded covered wire
4-Panel pillars
10-short rack screws
4-Short flat head pillar bolts
2-Meter lugs

3-16" pcs. shield mic cable 35-6/32 nuts and bolts 4-8/32 nuts 6-solder gnd lugs 1-line cord and plug R1-look--by R2-look-lw R3. 9-10 Ohms-lw R4, 5-47K-2w R6, 15k-lw R7 & R22 -47 ohms 1 W. R8. 21-7000 Ohms- 10w. R10-2, 2M-2w. R11-2200-5w. kl2-1.1M-2w. R13.17-220K-1w. R16-1500 Ohms-2w. $R14,18-20K-\frac{1}{2}w$ R19-400K-減w R20-200-10w

CL-1CO mmf C2, 3, 6, 7, 8-.002mf-500V and C5

04-15 mmf-500V

Ch 2-10H-150MA

FS1-3 Amp fuse

SW 1-DPST Transmit sw.

C10,14-10mf-50V C11-,1mf-400V C12,15,16,18-10mf-450V Can Cond. C13,17-.01mf-600V M-0-200MA J1-Key jack J2-Mic Jack SW1-DPDT Toggle RFC1,2,3,4-2.5MH-125MA CH 1-10H-150MA Power Supply R1,2-30K-20W C1,3-4mf 600V C2, 4-2mf-600V Ch 1-10H-80MA osc.

FINAL

```
32 TURNS # 22 WIRE
14 TURNS # 20 WIRE
                                 LINK 4 TO 6 TURNS
LINK 3 TO 5 TURNS
80 M
40 M
      8 TURNS #20 WIRE
20 M
                                 LINK 2 TO 4 TURNS
      6 TURNS # 20 WIRE LINK 2 TURNS
4 TURNS # 20 WIRE LINK 2 TURNS
M 21
M 01
        OSC. USE 20 M OSC. COIL
10 M
```

80 AND 40 M ARE CLOSE WOUND 20 15 10 SPREAD WINDING OVER 1 1/4 INCHES

80 M - 140 UUFD

40 M - 75 TO 100 UUFD

20 M - 50 UUFD

****** USE HAMMARLUND APC CAPACITORS

15 M - 35 UUFD 10 M - 25 UUFD

USE 80 AND 40 M FUNDAMENTAL TYPE CRYSTALS

K4XL's PAMA

This manual is provided FREE OF CHARGE from the "BoatAnchor Manual Archive" as a service to the Boatanchor community.

It was uploaded by someone who wanted to help you repair and maintain your equipment.

If you paid anyone other than BAMA for this manual, you paid someone who is making a profit from the free labor of others without asking their permission.

You may pass on copies of this manual to anyone who needs it. But do it without charge.

Thousands of files are available without charge from BAMA. Visit us at http://bama.sbc.edu