

Concerned Citizens for Washington Cemetery Care, Inc.
Monument Repair - Phase 4C
The Monument Company

30-Sep-98

Page 1 of 1

Lot No.	Name	No.	Size*	Scope*	Scope of Work	Cleaning	Repair	Pin Characteristics		
								Number of Pins	Pin Diameter	Pin Length
A-030	Norregaard	1	M	F D	Level on new foundation; drill & pin	15	435	2	0.75	6
A-043	Powers	1	S	F D	Level on new foundation; drill & pin	25	170	2	0.75	10
A-044	Zabel	1	XL	D	Drill, pin, & rejoin on existing base & foundation	35	760	4	.5,.5,1,1	8,8,14,22
A-076	Newhoff	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	110	2	0.75	8
A-087	Cook	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	95	2	1	10
A-089	Dupree	1	M	F D	Level on new foundation; drill & pin	25	370	1	1	19
A-096	Haralson	1	L	S D	Shim on existing foundation; drill & pin	35	345	3	.5, .75, 1	6, 8, 18
A-098	Moeller	1	L	D	Drill, pin, & rejoin on existing base & foundation	15	120	2	1	10
B-038	Sick	3	S	F D	Level on new foundation; drill & pin (move to foot of graves)	45	700	6	0.325	10
B-054	Stuer	1	XL	D	Drill, pin, & rejoin on existing base & foundation	15	550	2	1	10, 22
B-136	McQueen	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	0.75	16
B-136	Godbey, etc.	5	S/C	F D	Level 5 markers and at least 3 cradles	125	1450	5	0.375	8
C-013	Gaedke	2	M	D	Drill, pin, & rejoin on existing base & foundation	60	290	4	.5, .625	8, 8
C-015	Menger	1	XL	F D	Level on new foundation; drill & pin	35	735	3	.75, .75, 1	10, 10, 22
C-025	Souchard	1	XL	F D R	Level on new foundation; drill & pin; check old repair	35	685	4	.75, 1, 1, 1	8, 10, 22
C-047	Kirlicks	1	M	S D	Shim on existing foundations; drill & pin	25	270	2	0.625	20
C-061	Guese	1	M	D	Drill, pin, & rejoin on existing base & foundation	--	100	2	0.5	14
C-062	Buck	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	1	16
C-069	Weber	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	1	18
C-069	Minster	1	L	S D	Shim on existing foundation; drill & pin	25	220	2	0.75	10
C-137	Semlinger	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	150	1	1	16
F-024	Folse	1	XL	F D	Level on new foundation; drill & pin	25	?			
F-025	Garrett	1	S	D	Drill, pin, & rejoin on existing base & foundation	25	95	2	0.375	12
P-005	Moeller	1	XL	D R	Drill, pin, & rejoin on existing base & found.; replace cross	25	735	3	.375, 1, 1	6, 8, 28
Total Repairs		31	Average cost: 287		Number to be cleaned: 31	740	8,895			
Total, including cleaning			311				9,635			

*Scope: F - Foundation

D - Drill & pin

S - Shim

R - Repair

*Size: S - Under 2 ft. tall

M - 2-4 ft.

L - 4 -6 ft.

XL - Over 6 ft.

C - cradle

All joints to be secured by pinning and applying adhesive.

No vehicle over 5 tons is permitted in the cemetery.

Concerned Citizens for Washington Cemetery Care, Inc.
Monument Repair - Phase 4C
The Monument Company

Rev. 1 20-Mar-99

30-Sep-98

Page 1 of 1

Lot No.	Name	No.	Size*	Scope*	Scope of Work	Cleaning	Repair	Pin Characteristics		
								Number of Pins	Pin Diameter	Pin Length
✓ A-030	Norregaard	1	M	F D	Level on new foundation; drill & pin	15	435	2	0.75	6
✓ A-043	Powers	1	S	F D	Level on new foundation; drill & pin	25	170	2	0.75	10
A-044	Zabel	1	XL	D	Drill, pin, & rejoin on existing base & foundation	35	760	4	.5, .5, 1, 1	8, 8, 14, 22
A-076	Newhoff	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	110	2	0.75	8
✓ A-087	Cook	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	95	2	1	10
✓ A-089	Dupree	1	M	F D	Level on new foundation; drill & pin	25	370	1	1	19
✓ A-096	Haralson	1	L	S D	Shim on existing foundation; drill & pin	35	345	3	.5, .75, 1	6, 8, 18
✓ A-098	Moeller	1	L	D	Drill, pin, & rejoin on existing base & foundation	15	120	2	1	10
B-038	Sick	3	S	F D	Level on new foundation; drill & pin (move to foot of graves)	45	700	6	0.325	10
B-048	Kropp	1	S	D	Drill, pin, & rejoin head- & footstone on existing foundation	10	40	2	0.25	6
B-054	Stuer	1	XL	D	Drill, pin, & rejoin on existing base & foundation	15	550	2	1	10, 22
B-136	McQueen	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	0.75	16
B-136	Godbey, etc.	5	S/C	F D	Level 5 markers and at least 3 cradles	125	1450	5	0.375	8
C-013	Gaedke	2	M	D	Drill, pin, & rejoin on existing base & foundation	60	290	4	.5, .625	8, 8
C-015	Menger	1	XL	F D	Level on new foundation; drill & pin	35	735	3	.75, .75, 1	10, 10, 22
C-025	Souchard	1	XL	F D R	Level on new foundation; drill & pin; check old repair	35	685	4	.75, 1, 1, 1	8, 10, 22
C-047	Kirlicks	1	M	S D	Shim on existing foundations; drill & pin	25	270	2	0.625	20
C-060	Wise	1	S C	F D	Raise cradle and level on new foundation; drill & pin	35	315	2	0.375	6
✓ C-061	Guese	1	M	D	Drill, pin, & rejoin on existing base & foundation	--	100	2	0.5	14
C-062	Buck	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	1	16
C-069	Weber	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	1	18
C-069	Minster	1	L	S D	Shim on existing foundation; drill & pin	25	220	2	0.75	10
C-128	McCarty	1	M	F L	Recess limestone slab & install on new foundation	--	350			
C-137	Semlinger	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	150	1	1	16
F-024	Folse	1	XL	F D	Level on new foundation; drill & pin	20	320	1	1	12
F-024	Hoffman	1	M	F D	Level on new foundation; drill & pin	25	325	2	0.75	14
F-025	Garrett	1	S	D	Drill, pin, & rejoin on existing base & foundation	25	95	2	0.375	12
P-005	Moeller	1	XL	D R	Drill, pin, & rejoin on existing base & found.; replace cross	25	735	3	.375, 1, 1	6, 8, 28
S-340	Sandifer	1	S	F L	Recess limestone slab & install on new foundation	--	350			
Total Repairs		36	Average cost: 294		Number to be cleaned: 33	805	10,595			
Total, including cleaning			317				11,400			

*Scope: F - Foundation

D - Drill & pin

S - Shim

R - Repair

*Size: S - Under 2 ft. tall

M - 2-4 ft.

L - 4 -6 ft.

XL - Over 6 ft.

C - cradle

All joints to be secured by pinning and applying adhesive.

No vehicle over 5 tons is permitted in the cemetery.

Concerned Citizens for Washington Cemetery Care, Inc.
Monument Repair - Phase 4C
The Monument Company

Rev. 2 29-Mar-99

30-Sep-98

Page 1 of 1

Lot No.	Name	No.	Size*	Scope*	Scope of Work	Cleaning	Repair	Pin Characteristics		
								Number of Pins	Pin Diameter	Pin Length
A-030	Norregaard	1	M	F D	Level on new foundation; drill & pin	15	435	2	1	6
A-043	Powers	1	S	F D	Level on new foundation; drill & pin	25	170	2	1	10
A-044	Zabel	1	XL	D	Drill, pin, & rejoin on existing base & foundation	35	760	4	.5,.5,1,1	8,8,14,22
A-076	Newhoff	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	110	2	1	8
A-087	Cook	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	95	2	1	10
A-089	Dupree	1	M	F D	Level on new foundation; drill & pin	25	370	1	1	19
A-096	Haralson	1	L	S D	Shim on existing foundation; drill & pin	35	345	3	.5, .75, 1	6, 8, 18
A-098	Moeller	1	L	D	Drill, pin, & rejoin on existing base & foundation	15	120	2	1	10
B-038	Sick	3	S	F D	Level on new foundation; drill & pin (move to foot of graves)	45	700	6	.375	10
B-054	Stuer	1	XL	D	Drill, pin, & rejoin on existing base & foundation	15	550	2	1	10, 22
B-136	Godbey, etc.	5	S/C	F D	Level 5 markers and at least 3 cradles	125	1,450	5	1	8
C-013	Gaedke	2	M	D	Drill, pin, & rejoin on existing base & foundation	60	290	4	.5, .625	8, 8
C-015	Menger	1	XL	F D	Level on new foundation; drill & pin	35	735	3	.75, .75, 1	10, 10, 22
C-025	Souchard	1	XL	F D R	Level on new foundation; drill & pin; check old repair	35	685	4	.75, 1, 1, 1	8, 10, 22
C-047	Kirlicks	1	M	S D	Shim on existing foundations; drill & pin	25	270	2	1	20
C-062	Buck	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	1	16
C-069	Weber	1	L	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	1	18
C-069	Minster	1	L	S D	Shim on existing foundation; drill & pin	25	220	2	1	10
C-137	Semlinger	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	150	1	1	16
F-024	Folse	1	XL	F D	Level on new foundation; drill & pin	20	320	1	1	12
F-025	Garrett	1	S	D	Drill, pin, & rejoin on existing base & foundation	25	95	2	.375	12
F-030	Ollre	1	S	D	Drill, pin, & rejoin	N/C	N/C	2	.375	6
Total Repairs		29	Average cost:		Number to be cleaned: 29	685	8,210			
Total, including cleaning			307		Work Completed by 27 Mar. 99		8,895			
B-048	Kropp	1	S	D	Drill, pin, & rejoin head- & footstone on existing foundation	10	40	2	.375	6
B-136	McQueen	1	M	D	Drill, pin, & rejoin on existing base & foundation	25	170	1	1	16
C-060	Wise	1	S C	F D	Raise cradle and level on new foundation; drill & pin	35	315	2	.375	6
C-061	Guese	1	M	D	Drill, pin, & rejoin on existing base & foundation	--	100	2	1	14
C-128	McCarty	1	M	F L	Recess limestone slab & install on new foundation	--	350			
F-024	Hoffman	1	M	F D	Level on new foundation; drill & pin	25	325	2	1	14
P-005	Moeller	1	XL	D R	Drill, pin, & rejoin on existing base & found.; replace cross	25	735	3	.375, 1, 1	6, 8, 28
S-340	Sandifer	1	S	F L	Recess limestone slab & install on new foundation	--	350			
Total Repairs		8	Average cost:		Number to be cleaned: 5	120	2,385			
Total, including cleaning			313				2,505			
Total Repairs		37	Average cost:		Number to be cleaned: 34	805	10,595			
Total, including cleaning			308				11,400			

*Scope: F - Foundation D - Drill & pin

*Size: S - Under 2 ft. tall M - 2-4 ft.

All joints to be secured by pinning and applying adhesive.

S - Shim

L - 4 -6 ft.



No vehicle over 5 tons is permitted in the cemetery.

R - Repair

XL - Over 6 ft.

C - cradle



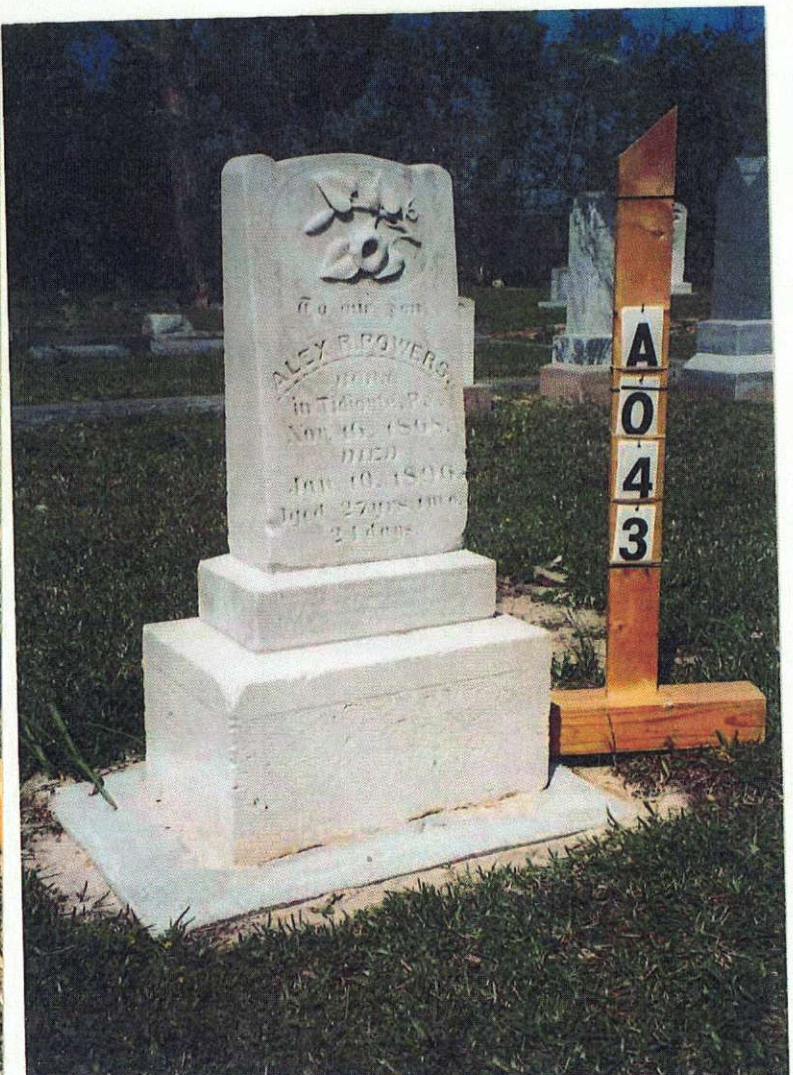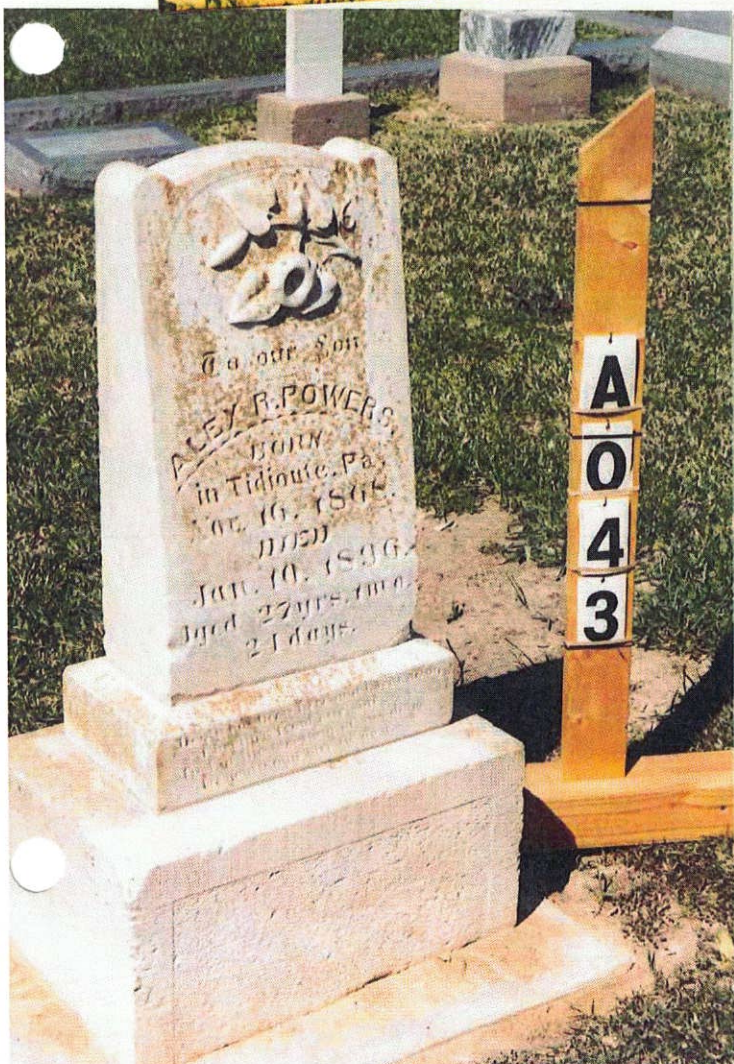





WM ZABEL
CEB. IN
BURC PRUSSIA
19 MAI 1831.
CEST.
14 OCT. 1896.
SAMPY KUSE DEINER ACHT

A
0
4
4

ZABEL



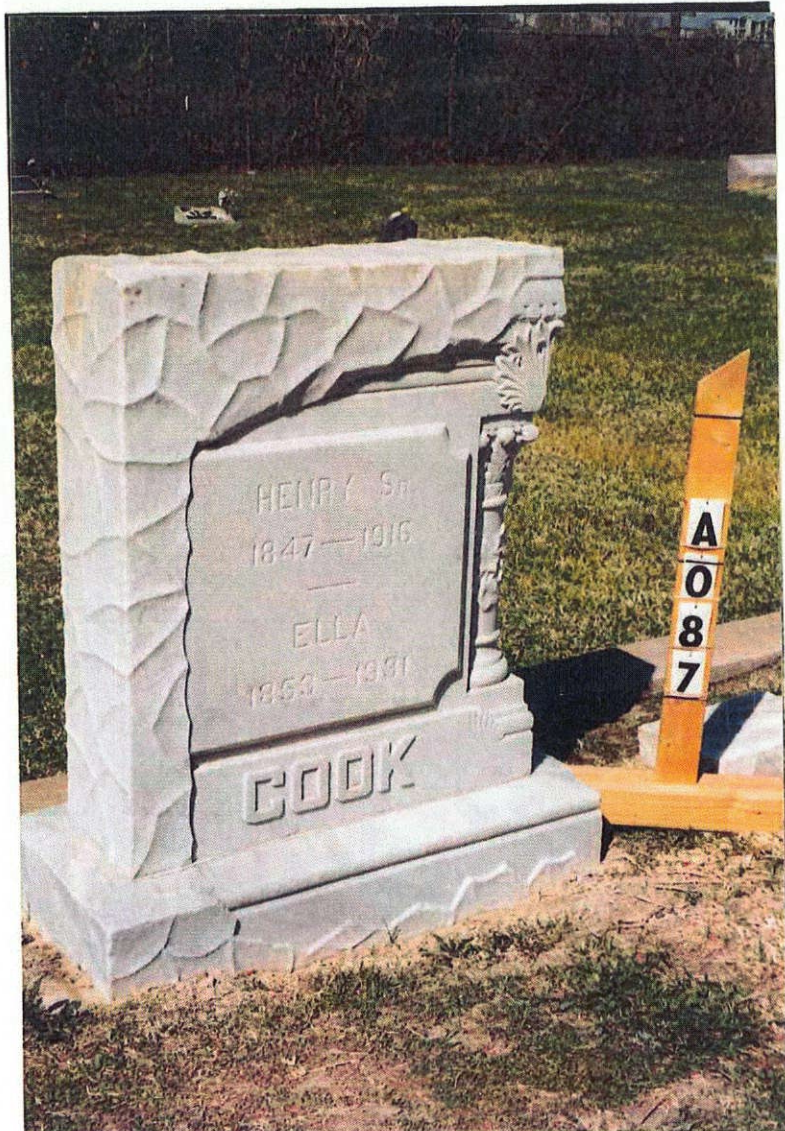


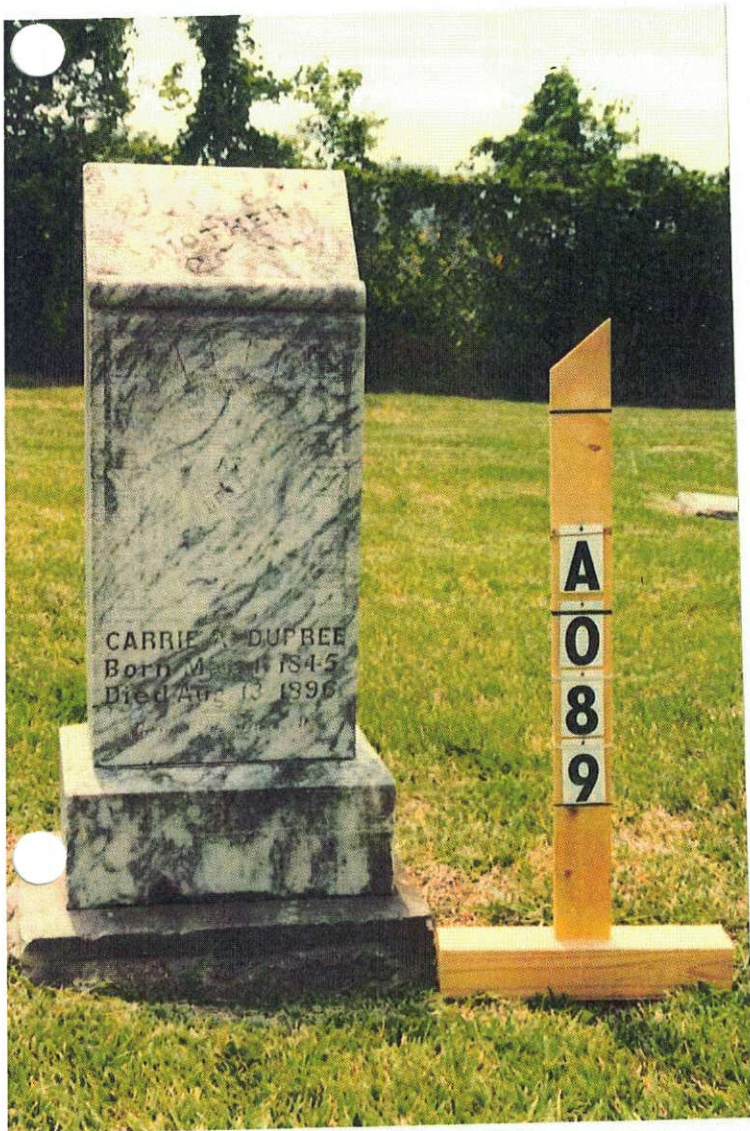








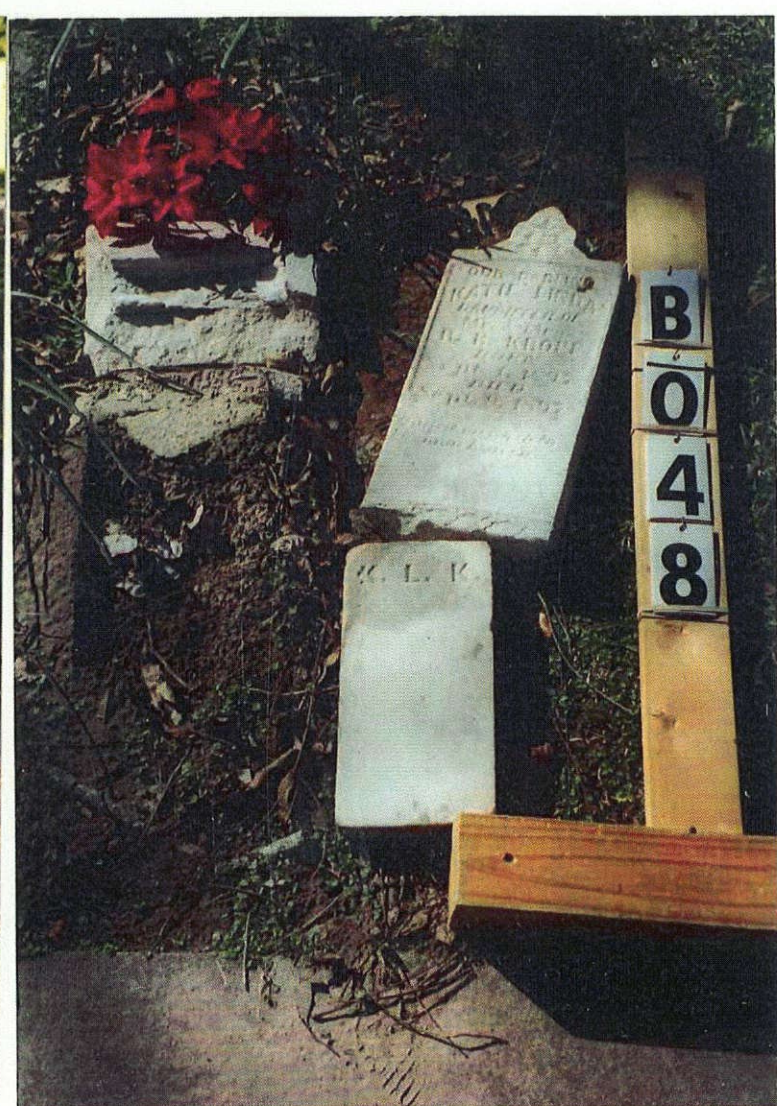









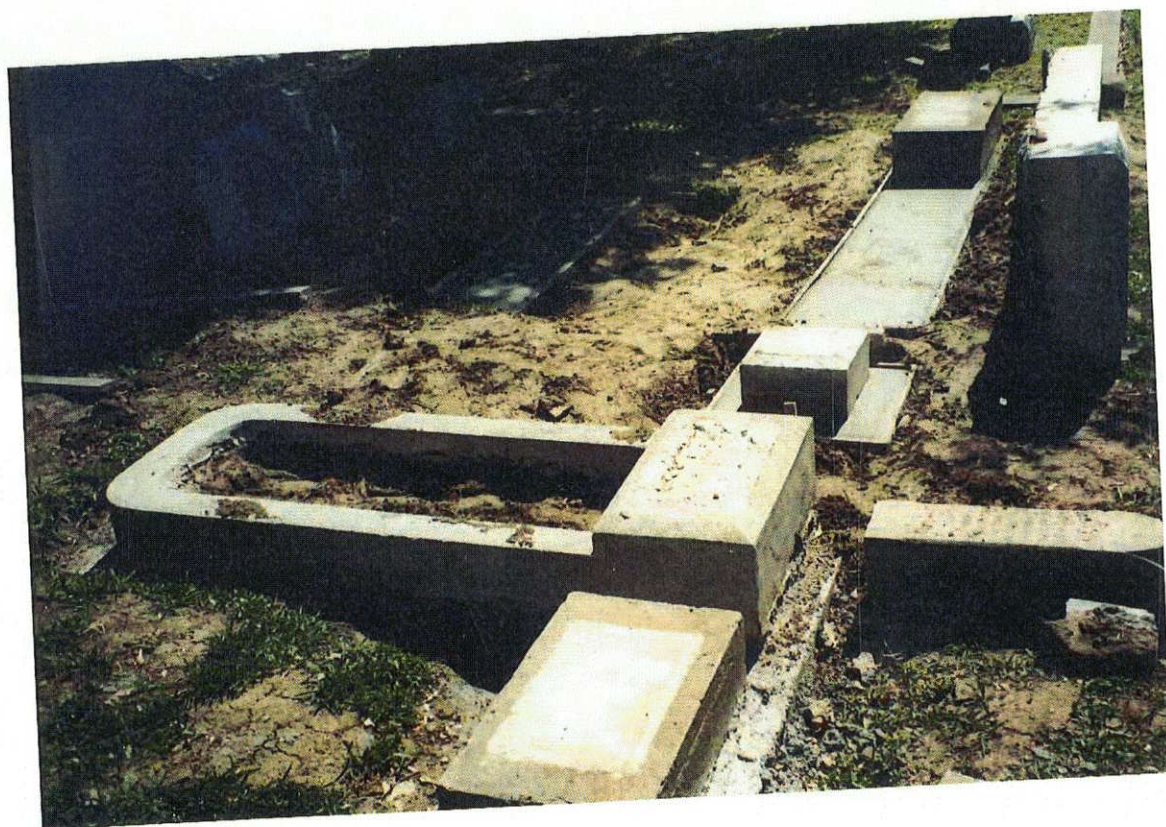

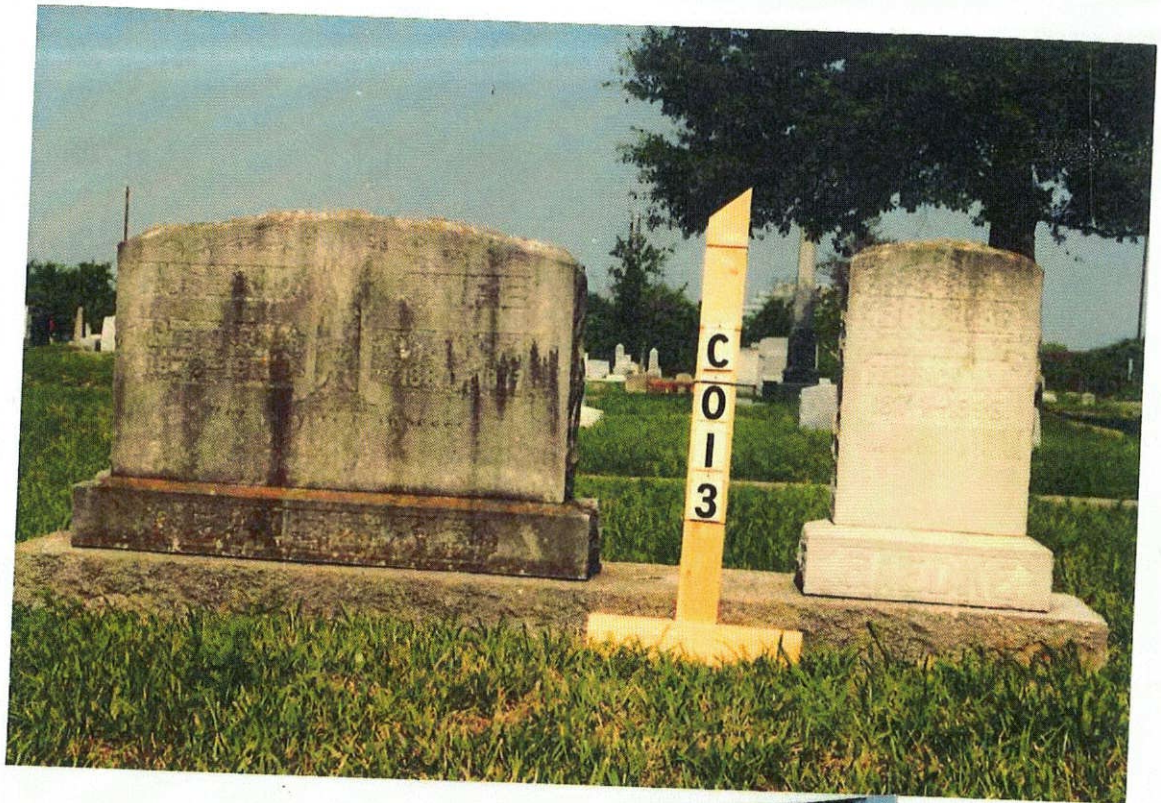





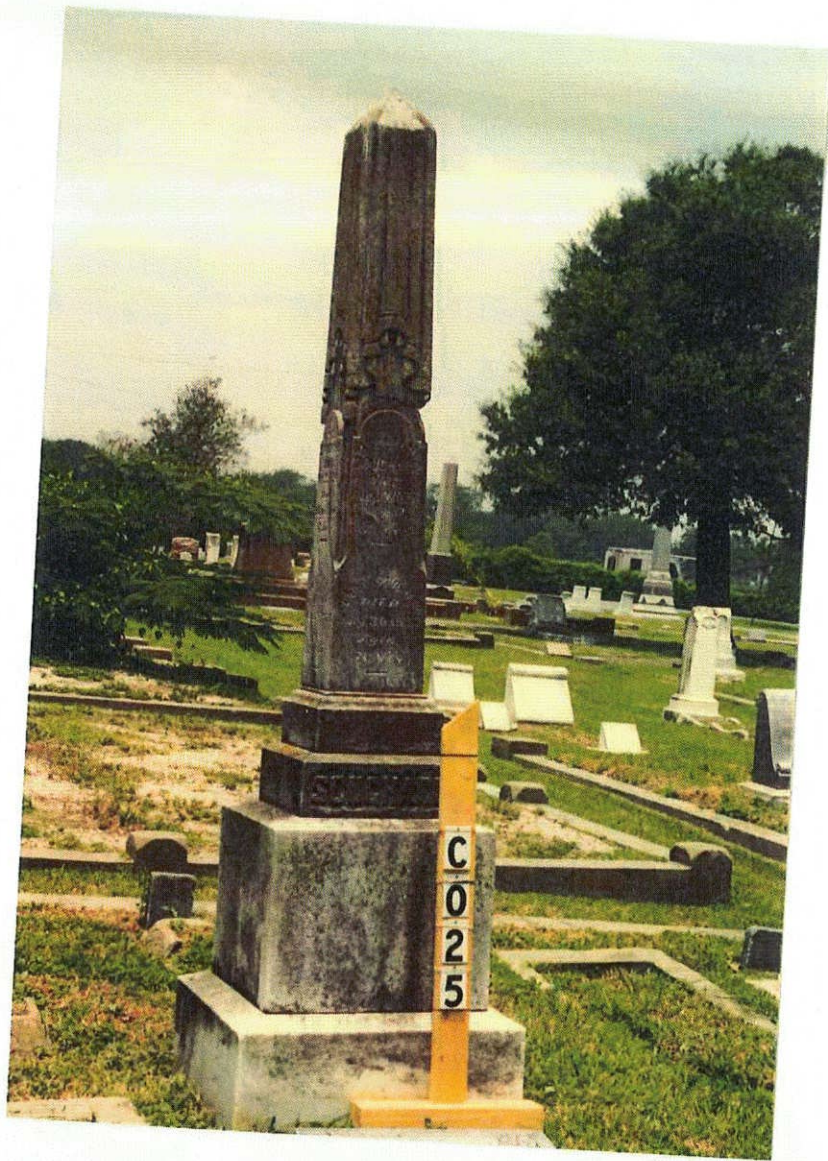







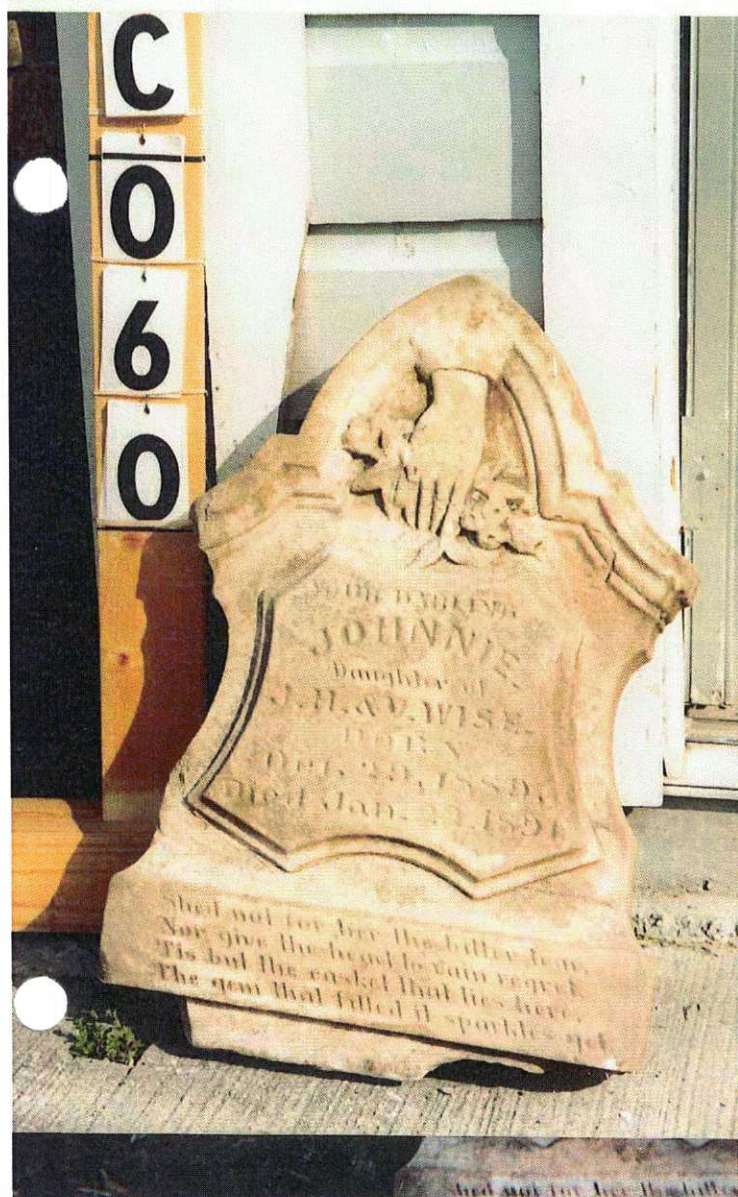

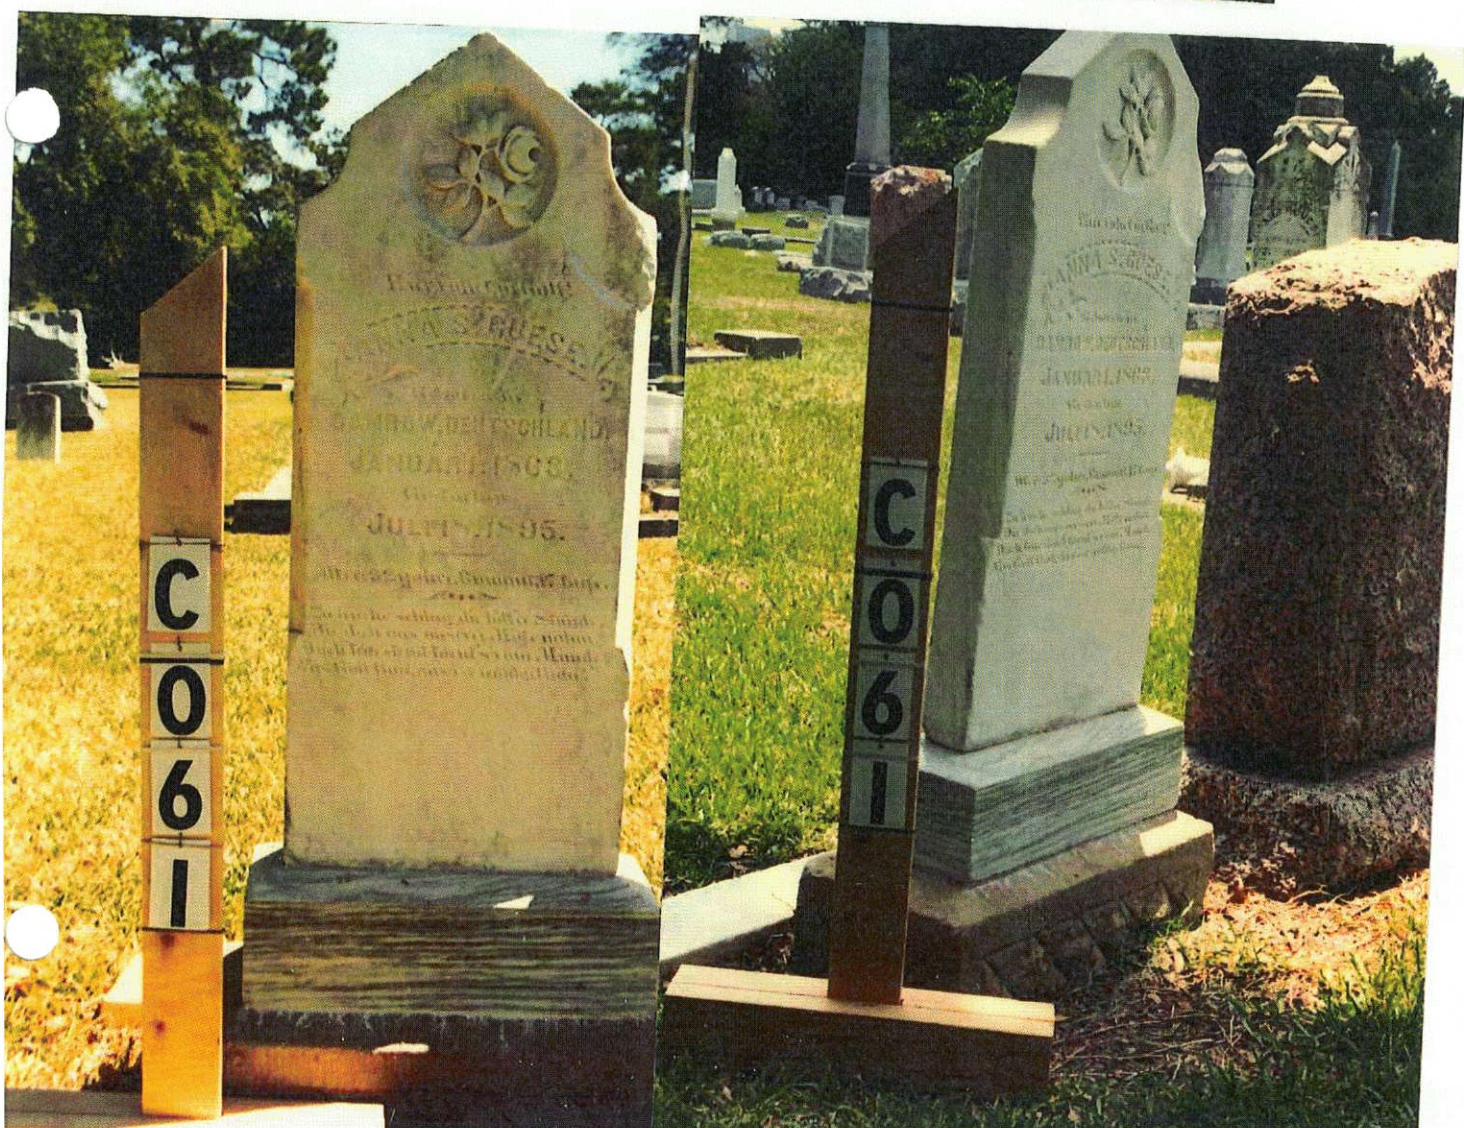

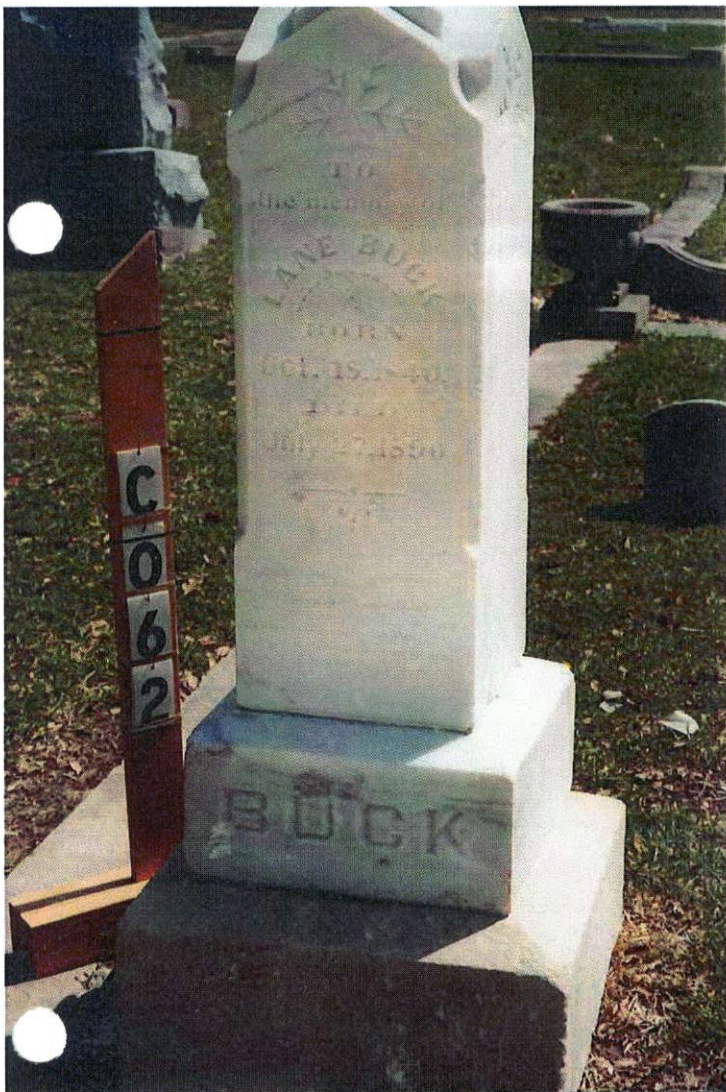



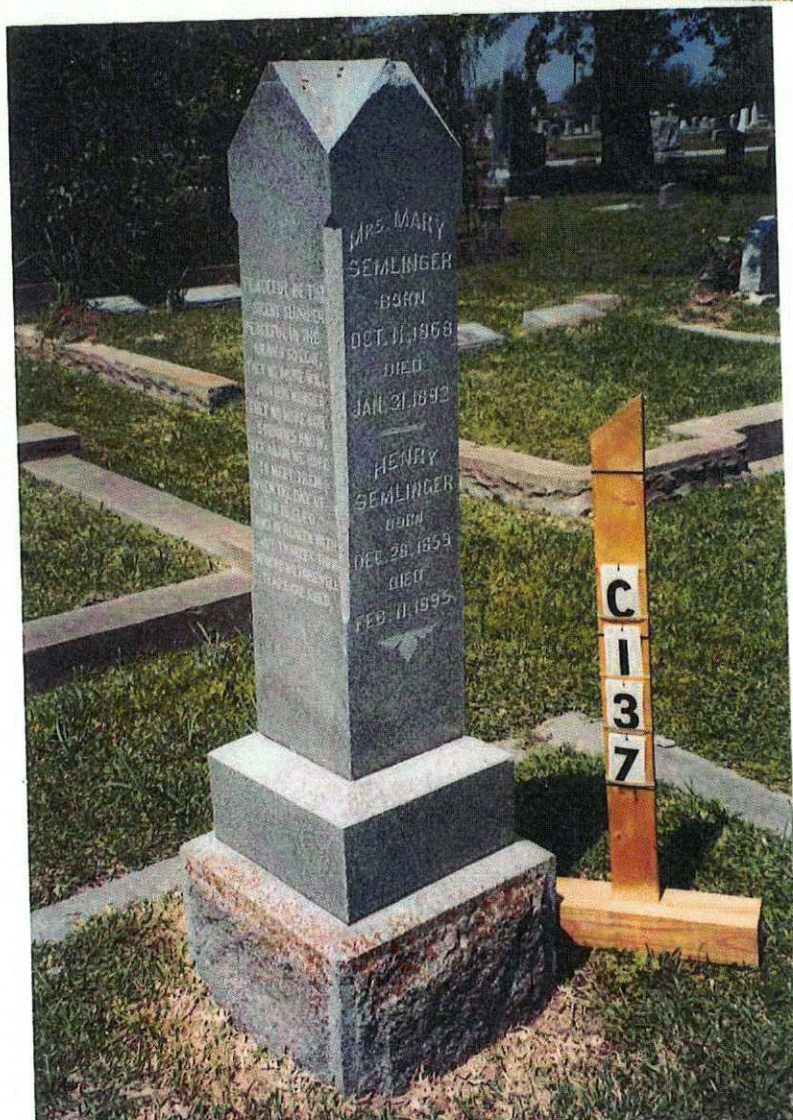









JOSEPH E.
OLLRE
TEXAS
PVT, 143 INF.
36 DIV.
OCTOBER 12, 1918

F
O
3
O

