

Washington Cemetery Historic Trust
Monument Repair - Phase 5A
The Monument Company

Rev. 1 8-Nov-1999

1-Sep-1999

Page 1 of 1

Lot No.	Name	No.	Size*	Scope*	Scope of Work	Repair	Cleaning	Pin Characteristics		
								Number of Pins	Pin Diameter	Pin Length
A-080	Heath	1	S	D R	Drill, pin, & reset in slot (broken at base) - plastic pins	60	10	1	0.500	5 (nylon)
B-063	Hines	1	S	D	Drill, pin, & rejoin on existing base & foundation	40	15	1	0.500	6
C-021	Congrove	1	S	F D	Level on new foundation; drill & pin	40	10	1	0.750	6
C-130	Smith	1	M	F D	Level on new foundation; repair base; drill & pin	130	20	2	0.500	8
C-130	Smith	1	C	F D	Raise cradle and level on new foundation	170	30	several	0.375	various
C-130	Dunkerley	1	S/C	F D R	Raise cradle and level on new foundation; add base; drill & pin	165	20	1	0.375	6 (nylon)
C-133	Loomis/Thompson	2	M/S	F D	Remove stump; level on new foundations; drill & pin ("DO LAST")	330	50	2 ea.	0.750	8
C-144	Stamm	1	S	F D	Level on new foundation; drill, pin, & reset in slot (no damage)	185	25	1	0.500	13
C-150	Dickey	1	S/C	D R	Raise cradle, repair break; drill, pin, & rejoin on existing foundation	205	20	2	0.500	6
F-006	Kessler	1	S	F D	Level on new foundation; drill & pin	205	20	2	0.375	4
F-009	O'Reilly	1	C	R	Repair corner on coping	25	---	---	---	---
G-021	Meek	2	M	D	Drill, pin, & rejoin on existing bases & foundations	80	40	2,1	.50,.75	12,13,10
G-021	Meek	1	C	F D	Repair cradle on new foundation	350	30	many	0.375	various
G-031	LaRose	3	M	D	Drill, pin, & rejoin 3 smaller ones on existing bases & foundations	240	60	3	0.750	9
G-031	LaRose	1	M	F D	Level on new foundation; drill & pin	205	25	1	0.750	8
G-031	LaRose	1	L	F D	Level on new foundation; drill & pin	310	35	1	0.750	20
G-047	Bisbee	1	S	D	Rejoin on existing base & foundation (has pins, but loose)	10	10	---	---	---
G-051	Mueller	1	S	D	Drill, pin, & rejoin on existing base & foundation	80	15	1	0.750	6
G-054	Lawler	1	M	D	Drill, pin, & rejoin on existing base & foundation	60	25	1	0.750	15
H-028	Mitchell	1	M	D	Drill, pin, & rejoin on existing base & foundation	150	15	4	0.375	3
		Average cost:								
Total Repairs		24		127	Number to be cleaned: 24		3,040	475		
Total, including cleaning				146				3,515		

*Scope: F - Foundation

D - Drill & pin

S - Shim

R - Repair

*Size: S - Under 2 ft. tall

M - 2-4 ft.

L - 4 -6 ft.

XL - Over 6 ft.


C - cradle

All joints to be secured by pinning and applying adhesive.

No vehicle over 5 tons is permitted in the cemetery.

* Need "Before" photo of Loomis and Thompson before work is done



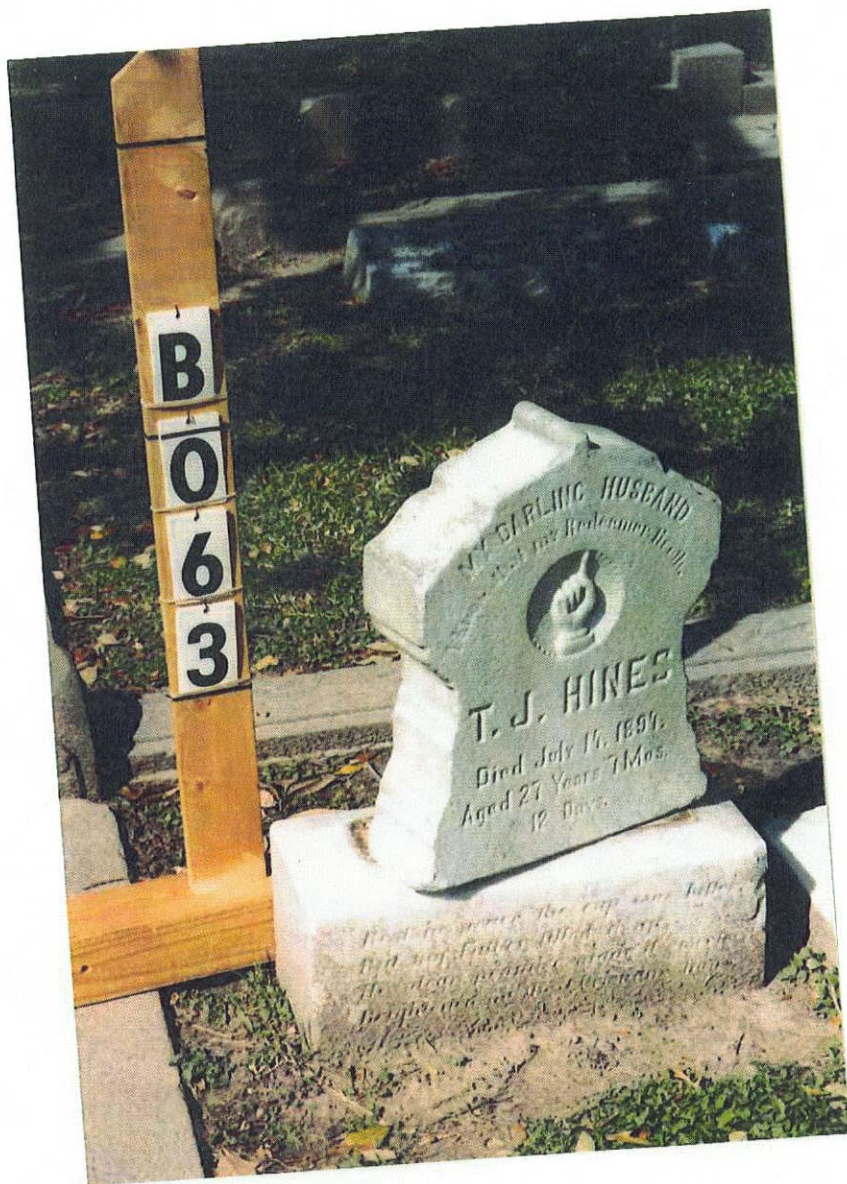



MRS. FLORA HOWARD
CONGROVE
DIED
APR 12 1917

