

Washington Cemetery Historic Trust
Monument Repair - Phase 5C
The Monument Company

9-Nov-1999

Page 1 of 1

Lot No.	Name	No.	Size*	Scope*	Scope of Work	Repair	Cleaning	Pin Characteristics		
								Number of Pins	Pin Diameter	Pin Length
B-012	Carl	2	M	D	Drill, pin, & rejoin on existing bases & foundations; clean cradles	120	50	2	0.750	17
B-014	Angerhoefer	1	XL	D	Drill, pin, & rejoin on existing base & foundation	240	75	1	1.000	25
C-087	Hahn	1	M	F	Level on new foundation; already pinned	125	25	--	--	--
C-128	Phillips	1	S	D R	Drill, pin, & reset in slot (broken at base)	100	15	1	0.375	6 (nylon)
C-130	Waegner	2	M	D	Drill, pin, & rejoin on existing bases & foundations	120	50	2	0.750	14
D-007	Bartsch	1	L	D	Drill, pin, & rejoin on existing base & foundation	60	25	1	0.750	14
D-074	Meyer	2	M	D	Drill, pin, & rejoin on existing bases & foundations	250	50	2	0.750	16
F-007	Howard	1	S	F D	Level on new foundation and base; drill & pin (first verify location!)	165	20	1	0.500	10
F-008	O'Day	1	M	D	Drill, pin, & rejoin on existing base & foundation	40	25	1	0.500	6
F-077	Evans	1	L	D	Drill, pin, & rejoin on existing base & foundation	100	40	1	1.000	14
F-025	Osborne	1	L	D	Drill, pin, & rejoin on existing base & foundation	120	35	1	0.750	18
F-078	Gunderson	1	S	F D	Level on new foundation and base; drill & pin (first verify location!)	165	20	1	0.375	6 (nylon)
F-078	Mackenzie	1	M	F D	Level on new foundation and base; drill & pin (first verify location!)	165	30	1	0.750	8
G-057	Pierson	1	M	D	Drill, pin, & rejoin on existing base & foundation	60	25	1	0.500	13
G-066	Younger	1	S	D	Drill, pin, & rejoin on existing base & foundation	60	15	1	0.500	10
G-092	Young	3	S	D	Drill, pin, & rejoin on existing bases & foundations	200	60	3	0.750	8
H-063	Alvarez	2	M	F D	Level on common foundation; drill & pin	330	30	2	0.750	8
Average cost:										
Total Repairs		23		105	Number to be cleaned: 23	2,420	590			
Total, including cleaning				131			3,010			

*Scope: F - Foundation

D - Drill & pin

S - Shim

R - Repair

*Size: S - Under 2 ft. tall

M - 2-4 ft.

L - 4 -6 ft.

XL - Over 6 ft.

C - cradle

All joints to be secured by pinning and applying adhesive.

No vehicle over 5 tons is permitted in the cemetery.

Washington Cemetery Historic Trust
Monument Repair - Phase 5C
The Monument Company

Rev. 1 30-Jan-2000

9-Nov-1999

Page 1 of 1

Lot No.	Name	No.	Size*	Scope*	Scope of Work	Repair	Cleaning	Pin Characteristics		
								Number of Pins	Pin Diameter	Pin Length
B-012	Carl	2	M	D	Drill, pin, & rejoin on existing bases & foundations; clean cradles	120	50	2	0.750	17
B-014	Angerhoefer	1	XL	D	Drill, pin, & rejoin on existing base & foundation	490	75	1	1.000	25
C-087	Hahn	1	M	F	Level on new foundation; already pinned	125	25	--	--	--
C-128	Phillips	1	S	D R	Drill, pin, & reset in slot (broken at base)	100	15	1	0.375	6 (nylon)
C-130	Waegner	2	M	D	Drill, pin, & rejoin on existing bases & foundations	120	50	2	0.750	14
D-007	Bartsch	1	L	D	Drill, pin, & rejoin on existing base & foundation	60	25	1	0.750	14
D-074	Meyer	2	M	D	Drill, pin, & rejoin on existing bases & foundations	250	50	2	0.750	16
F-007	Howard	1	S	F D	Level on new foundation and base; drill & pin (first verify location!)	165	20	1	0.500	10
F-008	O'Day	1	M	D	Drill, pin, & rejoin on existing base & foundation	40	25	1	0.500	6
F-025	Osborne	1	L	D	Drill, pin, & rejoin on existing base & foundation	120	35	1	0.750	18
F-077	Evans	1	L	D	Drill, pin, & rejoin on existing base & foundation	100	40	1	1.000	14
F-078	Gunderson	1	S	F D	Level on new foundation and base; drill & pin (first verify location!)	165	20	1	0.375	6 (nylon)
F-078	Mackenzie	1	M	F D	Level on new foundation and base; drill & pin (first verify location!)	165	30	1	0.750	8
G-057	Pierson	1	M	D	Drill, pin, & rejoin on existing base & foundation	60	25	1	0.500	13
G-066	Younger	1	S	D	Drill, pin, & rejoin on existing base & foundation	60	15	1	0.500	10
G-092	Young	3	S	D	Drill, pin, & rejoin on existing bases & foundations	200	60	3	0.750	8
H-063	Alvarez	2	M	F D	Level on common foundation; drill & pin	330	30	2	0.750	8
Average cost:										
Total Repairs		23		116	Number to be cleaned: 23	2,670	590			
Total, including cleaning				142			3,260			

*Scope: F - Foundation

D - Drill & pin

S - Shim

R - Repair

*Size: S - Under 2 ft. tall

M - 2-4 ft.


L - 4 -6 ft.

XL - Over 6 ft.

C - cradle

All joints to be secured by pinning and applying adhesive.

No vehicle over 5 tons is permitted in the cemetery.

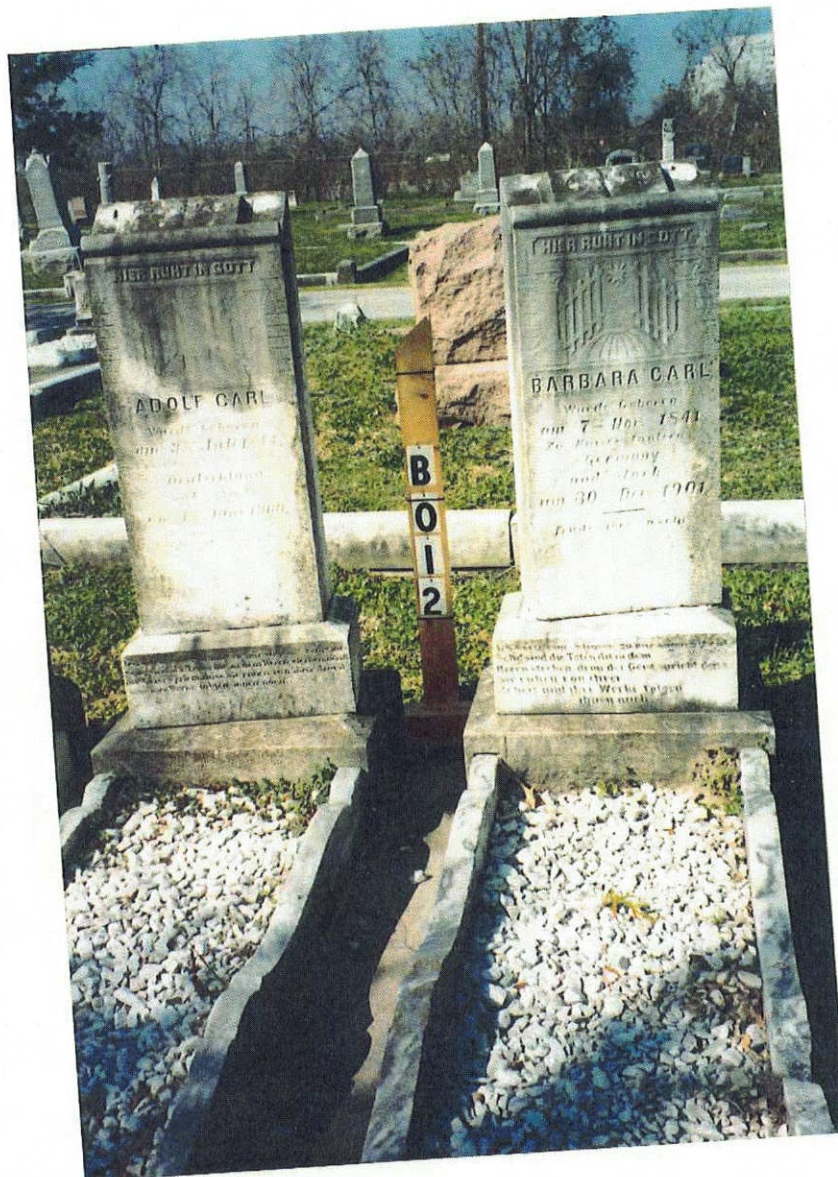

HIER RUHT IN GOTT

ADOLF CARL

geboren am 27. Juli 1844

gestorben am 1. Juni 1900

Alter 55 Jahre

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

Grabstein Nr. 1000

HIER RUHT IN GOTT

BARBARA CARL

geboren am 7. Nov. 1844

gestorben am 30. Dec. 1901

Alter 57 Jahre

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001



Grabstein Nr. 1001

Grabstein Nr. 1001

Grabstein Nr. 1001





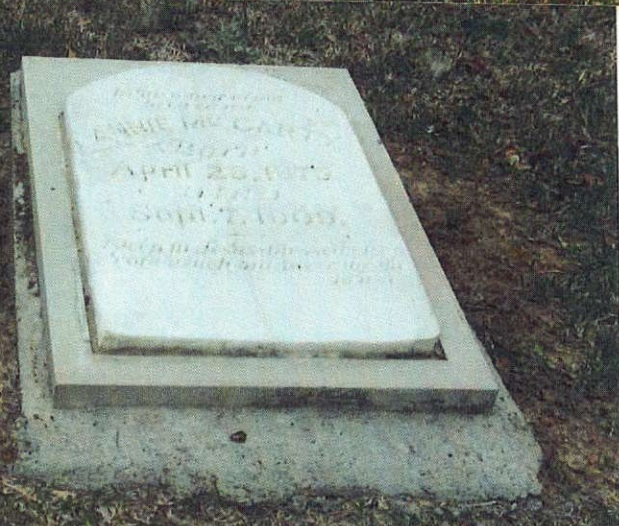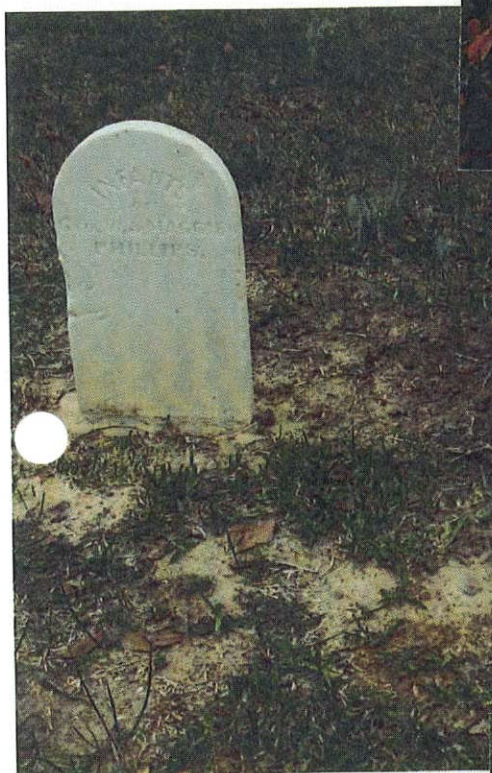













BORN
1897
DIED
1971

F
0
2
5













